

Appendix B – self-evaluation results

At the time of the ROW inventories, the city was following general ADA design guidance and procedures. This included a commitment to providing access to all users but does not have a formal policy or procedure to assign priority regarding ADA accessibility issues within the city. Implementing a method to assign priority will be a part of this plan effort.

Public right-of-way

Data collection for the PAR/PCR (city) self-evaluation was completed in August 2019. The self-evaluation of curb ramps and sidewalks/trails was performed by the city's consultants. The detailed inventory is found in B-1. The external agency traffic control signal map and inventory are found in B-2 and B-3.

This initial self-evaluation of PAR/PCR yielded the following results:



Figure 3. Self-Evaluation Results for Public Right-of-Way

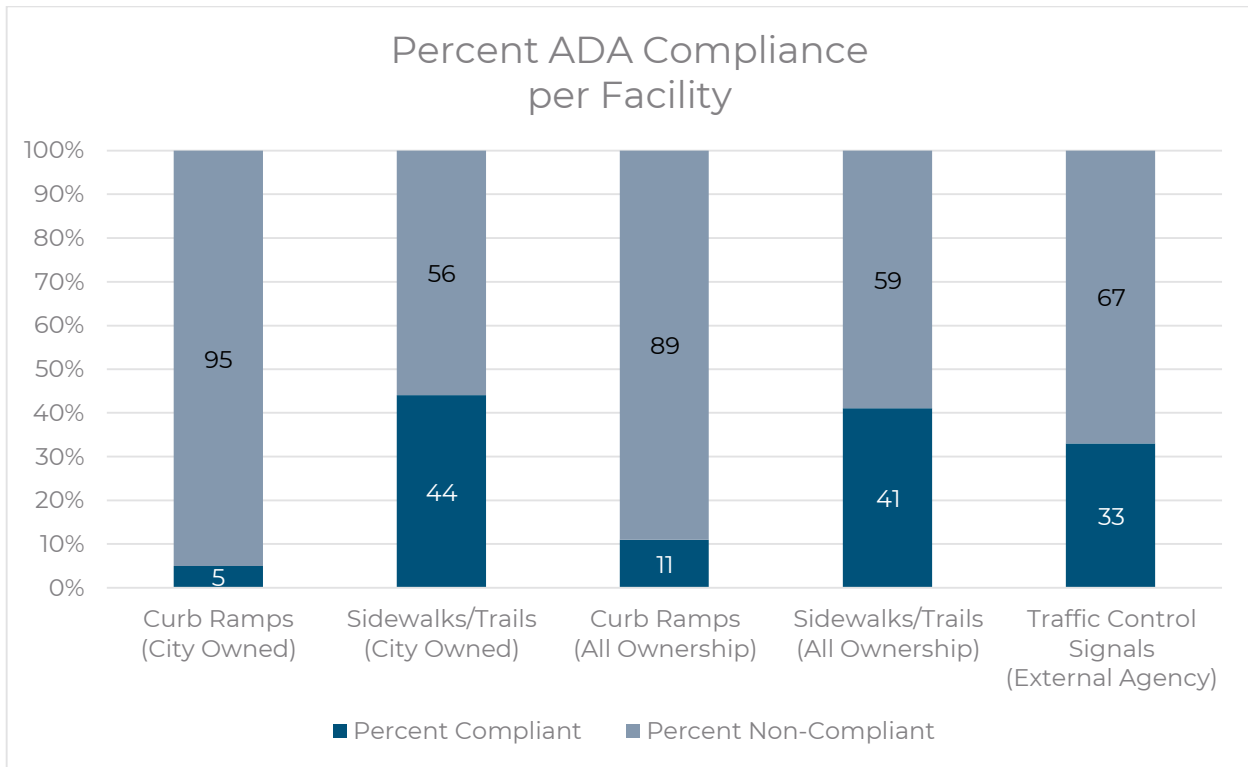


Chart description:

- 5% of curb ramps owned by the city were ADA compliant (11% of all curb ramps, including those owned by external agencies, were compliant).
- 44% of sidewalks/trails owned by the city were ADA compliant (41% of all sidewalks/trails, including those owned by external agencies, were compliant).
- 33% of traffic control signals owned by external agencies were ADA compliant.



B-1: Right-of-way self-evaluation inventory: curb ramps and sidewalks/trails



Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	3	Yes	.5	Yes	3.9	No	Yes	Yes	No	No			Poor		1.3	No	0
City	4	Yes	2.5	Yes	3.7	No	Yes	No	Yes	No			Fair		2.6	Yes	0
City	5	Yes	7.2	Yes	6.1	No	Yes	No	No	No			Good		3.5	Yes	0
City	6	Yes	4.6	Yes	5.7	No	Yes	No	No	No			Fair		4.6	No	0
City	7	Yes	2.5	Yes	4.3	No	Yes	No	No	No			Fair		3.3	Yes	0
City	8	Yes	3.8	Yes	2.4	No	Yes	No	No	No			Good		2.7	Yes	0
City	9	Yes	2.9	Yes	3.0	No	Yes	No	Yes	No			Good		3.4	Yes	0
City	10	Yes	3.5	Yes	4.1	No	Yes	No	No	No			Good		3.1	Yes	0
City	11	Yes	4.0	Yes	4.0	No	Yes	No	No	No			Good		3.1	Yes	0
City	12	Yes	3.1	Yes	6.0	No	Yes	No	No	No			Good		3.3	Yes	0
City	13	Yes	5.5	Yes	3.9	No	Yes	No	No	No			Good		2.4	Yes	0
City	14	Yes	3.4	Yes	4.9	No	Yes	No	No	No			Good		3.8	Yes	0
City	15	Yes	1.9	Yes	9.0	No	Yes	No	No	No			Good		4.8	Yes	0
City	16	Yes	0.4	Yes	8.1	No	Yes	Yes	No	No			Good		1.7	Yes	0
City	17	Yes	4.6	Yes	4.1	No	Yes	No	No	No			Good		2.4	Yes	0
City	18	Yes	2.4	Yes	4.2	No	Yes	No	Yes	No			Good		3.4	Yes	0
City	19	Yes	3.3	Yes	1.7	Yes	Yes	Yes	Yes	No			Good		2.0	Yes	0
City	20	Yes	1.2	Yes	2.4	No	Yes	No	Yes	No			Good		2.2	Yes	0
City	21	Yes	3.9	Yes	3.6	No	Yes	No	Yes	No			Good		2.3	Yes	0
City	22	Yes	4.1	Yes	1.9	Yes	Yes	No	No	No			Good		2.1	Yes	0
City	23	Yes	1.6	Yes	3.7	No	Yes	No	Yes	No			Good		2.6	Yes	0
City	24	Yes	3.9	Yes	1.0	Yes	Yes	No	Yes	No			Good		2.4	Yes	0
City	25	Yes	1.7	Yes	3.6	No	Yes	No	Yes	No			Good		2.4	Yes	0
City	26	Yes	4.0	Yes	3.4	No	Yes	Yes	Yes	No			Good		1.6	Yes	0
City	27	Yes	1.6	Yes	5.4	No	Yes	Yes	Yes	No			Good		0.4	Yes	0
City	28	Yes	1.5	Yes	3.7	No	Yes	No	Yes	No			Good		2.3	Yes	0
City	29	Yes	0.3	Yes	6.7	No	Yes	No	Yes	No			Good		4.2	No	0
City	30	Yes	2.9	Yes	4.4	No	Yes	No	Yes	No			Good		2.5	Yes	0
City	31	Yes	1.5	Yes	8.9	No	Yes	No	No	No			Fair		3.6	Yes	0
City	32	Yes	3.1	Yes	5.4	No	Yes	No	No	No			Good		2.6	Yes	0
City	33	Yes	4.0	Yes	7.8	No	Yes	No	No	No			Good		6.4	Yes	0
City	34	Yes	2.1	Yes	5.5	No	Yes	No	Yes	No			Fair		2.1	No	0
City	35	Yes	3.3	Yes	3.9	No	Yes	Yes	No	No			Fair		.8	Yes	0
City	36	Yes	4.6	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	37	Yes	8.6	No	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	42	Yes	2.0	Yes	2.9	No	Yes	Yes	No	No			Good		0.9	Yes	0
City	43	Yes	0.2	Yes	4.0	No	Yes	No	No	No			Good		2.4	Yes	0
City	44	Yes	3.5	Yes	3.9	No	Yes	Yes	No	No			Poor		1.9	No	0
City	45	Yes	1.4	Yes	1.9	Yes	Yes	Yes	Yes	No			Good	crosswalk many holes	1.5	Yes	0
City	46	Yes	4.0	Yes	6.0	No	Yes	No	No	No			Good		2.4	Yes	0
City	47	Yes	5.9	Yes	4.0	No	Yes	No	No	No			Good		2.3	Yes	0
City	48	Yes	1.8	Yes	3.5	No	Yes	Yes	Yes	No			Fair		1.9	No	0
City	49	Yes	5.2	Yes	3.3	No	Yes	No	No	No			Good		2.4	No	0
City	50	Yes	6.2	Yes	0.1	Yes	Yes	No	Yes	Yes	Yes	Yes	Poor		2.6	Yes	0
City	51	Yes	5.0	Yes	0.1	Yes	Yes	No	No	Yes	Yes	Yes	Fair	crack at top of ramp more than 1"	5.1	Yes	0
City	54	Yes	8.2	Yes	5.7	No	Yes	No	No	No			Good		3.2	Yes	0
City	55	Yes	3.9	Yes	5.9	No	Yes	No	No	No			Good		2.5	Yes	0
City	56	Yes	6.2	Yes	5.3	No	Yes	No	No	Yes			Good		3.8	Yes	0
City	57	Yes	2.0	Yes	3.4	No	Yes	No	No	Yes	Yes	Yes	Good		3.1	Yes	0
City	58	Yes	6.3	Yes	8.9	No	Yes	No	No	No			Poor		3.3	No	0
City	59	Yes	6.4	Yes	3.4	No	Yes	Yes	No	No			Poor		1.7	No	0
City	60	Yes	9.0	No	3.6	No	Yes	No	Yes	No			Fair	Ponding due to grate being closed	2.3	Yes	0
City	61	Yes	2.7	Yes	1.8	Yes	Yes	Yes	No	No			Good		1.5	Yes	0
City	62	Yes	4.0	Yes	3.5	No	Yes	Yes	Yes	No			Good		2.0	Yes	0
City	63	Yes	0.6	Yes	4.7	No	Yes	No	No	No			Good		4.0	Yes	0
City	64	Yes	1.3	Yes	5.5	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	0
City	65	Yes	5.5	Yes	2.9	No	Yes	No	Yes	No			Good		2.6	Yes	0
City	66	Yes	6.7	Yes	3.8	No	Yes	No	Yes	No			Good		3.7	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	67	Yes	7.1	Yes	9.2	No	Yes	No	Yes	No			Good		3.8	Yes	0
City	68	Yes	11.0	No	1.3	Yes	Yes	No	No	No			Good		6.8	Yes	0
City	69	Yes	9.0	No	3.6	No	Yes	No	No	No			Good		4.4	Yes	0
City	70	Yes	5.0	Yes	3.0	No	Yes	No	Yes	No			Good		3.0	Yes	0
City	71	Yes	3.6	Yes	1.7	Yes	Yes	No	Yes	No			Good		3.0	Yes	0
City	72	Yes	6.1	Yes	1.3	Yes	Yes	No	Yes	No			Good		3.3	Yes	0
City	73	Yes	4.6	Yes	0.9	Yes	Yes	Yes	Yes	No			Good		0.7	Yes	0
City	74	Yes	5.3	Yes	0.1	Yes	Yes	Yes	Yes	No			Good		0.5	Yes	0
City	75	Yes	5.9	Yes	0.2	Yes	Yes	No	Yes	No			Good		2.1	Yes	0
City	76	Yes	4.2	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
City	77	Yes	5.4	Yes	2.3	No	Yes	No	Yes	No			Good		2.5	Yes	0
City	78	Yes	6.0	Yes	1.5	Yes	Yes	No	Yes	No			Good		4.0	Yes	0
City	79	Yes	4.7	Yes	2.7	No	Yes	Yes	Yes	No			Good		1.6	Yes	0
City	80	Yes	3.9	Yes	0.9	Yes	Yes	No	No	No			Good		2.9	Yes	0
City	81	Yes	2.7	Yes	1.8	Yes	Yes	Yes	Yes	No			Good		0.6	Yes	0
City	82	Yes	4.0	Yes	3.7	No	Yes	No	Yes	No			Good		4.1	Yes	0
City	83	Yes	3.1	Yes	2.3	No	Yes	No	Yes	No			Good		3.0	Yes	0
City	84	Yes	7.4	Yes	0.5	Yes	Yes	Yes	Yes	No			Good		1.6	Yes	0
City	85	Yes	6.0	Yes	0.5	Yes	Yes	No	No	No			Good		2.7	Yes	0
City	86	Yes	4.4	Yes	3.3	No	Yes	No	No	No			Fair	crosswalk has large chunks missing	2.4		0
City	87	Yes	3.4	Yes	0.1	Yes	Yes	No	Yes	No			Good		2.1	No	0
City	88	Yes	3.7	Yes	0.2	Yes	Yes	No	No	No			Good		4.3	Yes	0
City	91	Yes	1.8	Yes	1.5	Yes	Yes	No	No	No			Good		2.1	Yes	0
City	92	Yes	0.3	Yes	1.3	Yes	Yes	No	No	No			Good		2.3	Yes	0
City	93	Yes	0.2	Yes	1.9	Yes	Yes	Yes	Yes	No			Good		0.7	Yes	0
City	94	Yes	1.5	Yes	1.8	Yes	Yes	No	No	No			Good		3.7	Yes	0
City	95	Yes	7.6	Yes	0.8	Yes	No	No	No	No			Fair		3.1	Yes	0
City	96	Yes	9.9	No	0.2	Yes	Yes	No	No	Yes	Yes	No	Good	Gap and ponding	3.9	No	0
City	97	Yes	1.3	Yes	0.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	109	Yes	6.4	Yes	1.4	Yes	Yes	No	Yes	Yes	Yes	Yes	Fair	Ponding	3.4	Yes	0
City	110	Yes	4.8	Yes	0.0	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Ponding	6.3	Yes	0
City	111	Yes	5.5	Yes	0.2	Yes	Yes	No	No	No			Good		4.4	Yes	0
City	112	Yes	1.8	Yes	2.3	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation	2.8	Yes	0
City	113	Yes	3.6	Yes	3.5	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Some vegetation	2.3	Yes	0
City	114	Yes	5.2	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.9	Yes	1
City	115	Yes	4.8	Yes	0.6	Yes	Yes	No	Yes	Yes	Yes	Yes	Fair		3.1	Yes	0
City	117	Yes	9.9	No	0.3	Yes	Yes	No	Yes	Yes	Yes	Yes	Fair	Some cracking and vegetation	7.3	Yes	0
City	119	Yes	0.8	Yes	3.3	No	Yes	Yes	Yes	Yes	Yes	Yes	Good	Under construction	1.6	Yes	0
City	120	Yes	2.3	Yes	4.9	No	Yes	No	No	Yes	Yes	Yes	Good	Some vegetation	3.7	Yes	0
City	121	Yes	4.7	Yes	7.4	No	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Some vegetation	1.5	Yes	0
City	122	Yes	4.1	Yes	2.1	No	Yes	Yes	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation	0.6	Yes	0
City	123	Yes	3.9	Yes	0.3	Yes	Yes	No	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation	2.1	Yes	0
City	124	Yes	9.6	No	2.2	No	Yes	No	No	No			Good		3.8	Yes	0
City	126	Yes	7.5	Yes	9.4	No	Yes	No	No	No			Fair		2.6	Yes	0
City	127	Yes	6.3	Yes	6.8	No	Yes	No	No	No			Good		5.8	Yes	0
City	248	Yes	3.6	Yes	0.9	Yes	Yes	No	No	Yes	Yes	Yes	Good	Under construction	5.2	No	0
City	249	Yes	3.7	Yes	1.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.5	Yes	0
City	250	Yes	3.7	Yes	0.3	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	3.9	Yes	0
City	251	Yes	3.1	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	3.8	Yes	0
City	252	Yes	7.5	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	8.4	Yes	0
City	253	Yes	2.0	Yes	0.9	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.5	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	254	Yes	6.3	Yes	1.5	Yes	No	Yes	Yes	No			Good		0.9	Yes	0
City	255	Yes	5.1	Yes	0.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
City	256	Yes	7.2	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	7.1	Yes	0
City	257	Yes	4.8	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good	Ponding and under construction	0.4	Yes	1
City	258	Yes	6.7	Yes	1.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.7	Yes	0
City	259	Yes	4.2	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	261	Yes	2.0	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.5	Yes	0
City	262	Yes	0.7	Yes	0.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.3	Yes	1
City	263	Yes	2.2	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.7	Yes	0
City	264	Yes	1.6	Yes	1.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		na	Yes	0
City	265	Yes	1.0	Yes	2.6	No	Yes	No	No	Yes	Yes	Yes	Good		3.3	Yes	0
City	272	Yes	0.3	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.7	Yes	0
City	273	Yes	2.8	Yes	1.6	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	2.5	Yes	0
City	274	Yes	5.3	Yes	1.6	Yes	Yes	No	No	Yes	Yes	Yes	Good	Potholes	2.2	No	0
City	275	Yes	3.1	Yes	2.9	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
City	278	Yes	1.6	Yes	2.0	Yes	Yes	N/A	Yes	No			Good		na	Yes	0
City	279	Yes	8.7	No	0.1	Yes	Yes	Yes	No	No			Good		1.0	Yes	0
City	280	Yes	5.9	Yes	3.8	No	Yes	No	No	No			Good		5.0	Yes	0
City	281	Yes	24.3	No	0.9	Yes	Yes	No	No	No			Poor	very steep curb slope	5.4	Yes	0
City	282	No															0
City	283	Yes	4.8	Yes	1.7	Yes	Yes	No	Yes	No			Poor	curb not flush	4.8	No	0
City	284	Yes	1.5	Yes	2.3	No	Yes	Yes	No	No			Poor	curb not flush	1.9	No	0
City	285	Yes	6.6	Yes	1.4	Yes	Yes	No	No	No			Good		19	Yes	0
City	286	Yes	6.5	Yes	0.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	287	Yes	0.8	Yes	2.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	0
City	291	Yes	7.8	Yes	1.5	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	2.2	Yes	0
City	292	Yes	4.6	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.4	Yes	0
City	293	Yes	8.8	No	1.6	Yes	Yes	No	No	No			Fair		2.6		0
City	294	Yes	11.0	No	4.3	No	Yes	No	No	No			Good		3.9	Yes	0
City	295	Yes	4.5	Yes	0.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.0	Yes	0
City	296		1.6	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.9	Yes	0
City	297	Yes	2.2	Yes	1.4	Yes	Yes	No	Yes	Yes	Yes	Yes	Good	Ponding and under construction	2.2	Yes	0
City	298	Yes	1.8	Yes	0.8	Yes	Yes	No	Yes	Yes	Yes	Yes	Good	Ponding and under construction	1.7	Yes	0
City	299	Yes	3.3	Yes	0.8	Yes	Yes	No	Yes	No			Good	curb not flush	2.9		0
City	343	Yes	2.5	Yes	1.6	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	2.7	Yes	0
City	344	Yes	7.9	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	7.4	Yes	0
City	345	Yes	6.7	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	7.4	Yes	0
City	346	Yes	0.1	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.3	Yes	0
City	347	Yes	11.7	No	1.6	Yes	No	No	No	No			Fair		2.2	Yes	0
City	348	Yes	2.4	Yes	3.5	No	Yes	No	No	Yes	Yes	Yes	Good		2.7	Yes	0
City	349	Yes	4.4	Yes	4.5	No	Yes	No	No	Yes	Yes	Yes	Good		4.1	Yes	0
City	375	Yes	5.6	Yes	1.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes			1.7	Yes	1
City	376	Yes	7.2	Yes	0.2	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding	4.8	Yes	0
City	377	Yes	0.9	Yes	0.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	1
City	378	Yes	1.0	Yes	0.4	Yes	Yes	N/A		Yes	Yes	Yes	Good	Ponding	na	Yes	1
City	379	Yes	3.4	Yes	0.9	Yes	Yes	Yes		Yes	Yes	Yes	Good	Ponding	1.5	Yes	1

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	400	Yes	3.1	Yes	0.3	Yes	Yes	Yes	No	No			Good		1.8	Yes	0
City	401	Yes	3.7	Yes	0.4	Yes	Yes	Yes	No	No			Good		1.7	Yes	0
City	402	Yes	4.5	Yes	2.8	No	Yes	Yes	No	No			Good		1.1	Yes	0
City	403	Yes	2.3	Yes	1.0	Yes	No	Yes	No	No			Good		0.4	Yes	0
City	404	Yes	2.9	Yes	0.1	Yes	No	No	No	No			Fair	Some vegetation	2.3		0
City	405	Yes	0.4	Yes	1.1	Yes	Yes	N/A	No	No			Good		1.1	Yes	0
City	406	Yes	1.4	Yes	1.5	Yes	Yes	N/A	No	No			Good	Ponding	1.5	Yes	0
City	407	No	0.5	Yes	0.7	Yes	Yes	Yes		No			Good	22 percent curb	0.7		0
City	408	Yes	7.0	Yes	3.8	No	Yes	Yes		No			Good	Ponding	1.8	No	0
City	568	Yes	11.8	No	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Some vegetation	1.0	Yes	0
City	569	Yes	4.0	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair		0.1	Yes	1
City	570	Yes	0.6	Yes	2.7	No	Yes	No		Yes	Yes	Yes	Fair	Some vegetation	2.9		0
City	571	Yes	2.9	Yes	10.5	No	Yes	No	No	Yes	No		Fair	Some vegetation	2.1		0
City	572	Yes	9.0	No	7.0	No	Yes	No	No	Yes	Yes	Yes	Good		2.4	No	0
City	573	Yes	10.1	No	4.8	No	Yes	No	No	Yes	Yes	Yes	Fair		9.1	No	0
City	574	Yes	6.7	Yes	3.5	No	Yes	No	No	No			Fair	Some vegetation	3.4		0
City	575	Yes	4.6	Yes	2.0	Yes	Yes	No	No	No			Fair	Some cracking	3.2	Yes	0
City	576	Yes	8.2	Yes	2.1	No	Yes	No		No			Fair	Some vegetation	2.1	No	0
City	577	Yes	3.2	Yes	0.4	Yes		Yes		No			Good		1.5	Yes	0
City	578	Yes	5.3	Yes	4.6	No	Yes	No		No			Good		2.9	Yes	0
City	579	Yes	7.6	Yes	1.8	Yes		No		No			Fair	Some vegetation	7.6		0
City	871	Yes	2.9	Yes	3.2	No	Yes	No	No	No			Good		2.9	Yes	0
City	872	Yes	1.4	Yes	2.3	No	Yes	Yes	No	No			Good		1.8	Yes	0
City	873	Yes	6.0	Yes	9.2	No	Yes	No		No			Fair	Ponding	6.1	Yes	0
City	874	Yes	5.2	Yes	4.8	No	Yes	No	No	No			Good		3.6	Yes	0
City	875	Yes	0.5	Yes	2.0	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
City	876	Yes	5.3	Yes	3.0	No	Yes	Yes	No	No			Good		0.2	Yes	0
City	877	Yes	0.3	Yes	1.7	Yes	No	Yes	No	No			Good		1.7	Yes	0
City	878	Yes	1.8	Yes	2.5	No	Yes	Yes	Yes	No			Fair	Ponding	2.4	Yes	0
City	879	Yes	3.6	Yes	2.4	No	Yes	No	Yes	No			Fair	Ponding	2.2	Yes	0
City	880	Yes	1.9	Yes	0.2	Yes	Yes	Yes	Yes	No			Good		1.9	Yes	0
City	881	Yes	2.8	Yes	2.1	No	Yes	Yes	Yes	No			Good		1.5	Yes	0
City	882	Yes	2.7	Yes	1.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.5	Yes	0
City	883	Yes	0.6	Yes	1.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation	1.6	Yes	1
City	906	Yes	3.6	Yes	4.8	No	Yes	No	No	No			Fair	Ponding	2.5	Yes	0
City	907	Yes	1.2	Yes	1.7	Yes	Yes	Yes	Yes	No			Good		1.7	Yes	0
City	908	Yes	1.3	Yes	5.0	No	Yes	No	Yes	No			Good		3.3	Yes	0
City	909	Yes	1.6	Yes	4.4	No	Yes	Yes	Yes	No			Good		1.2	Yes	0
City	910	Yes	4.7	Yes	0.8	Yes	Yes	No	Yes	Yes	Yes	Yes	Fair	Ponding	2.8	Yes	0
City	911	Yes	0.5	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.5	Yes	1
City	924	Yes	4.7	Yes	7.9	No	Yes	No	No	No			Good		4.9	Yes	0
City	925	Yes	12.0	No	1.3	Yes	Yes	Yes	No	No	No	No	Fair	Some vegetation	2.0	Yes	0
City	926	Yes	8.4	No	1.3	Yes	No	Yes	No	No			Good		2.0	Yes	0
City	927	Yes	7.5	Yes	3.5	No	Yes	No	No	No			Fair	Ponding	2.5	Yes	0
City	928	Yes	11.1	No	1.7	Yes	Yes	No	No	No			Fair	Some vegetation	4.1	Yes	0
City	929	Yes	8.0	Yes	6.8	No	Yes	N/A		No			Good		na	Yes	0
City	930	Yes	6.9	Yes	2.9	No	Yes	No	No	No			Good		2.3	Yes	0
City	931	Yes	7.8	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0
City	932	Yes	7.1	Yes	2.6	No	Yes	No	No	No			Fair	Ponding	4.0	Yes	0
City	933	Yes	7.5	Yes	2.8	No	Yes	Yes	Yes	No			Fair	Some vegetation	0.9	Yes	0
City	1373	Yes	4.7	Yes	5.6	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
City	1374	Yes	7.7	Yes	6.2	No	Yes	No	No	Yes	Yes	Yes	Fair	Some vegetation	2.5	Yes	0
City	1375	Yes	4.7	Yes	6.7	No	Yes	Yes	No	No			Good		1.5	Yes	0
City	1376	Yes	8.9	No	3.2	No	Yes	No	No	No			Good		2.8	Yes	0
City	1377	Yes	6.9	Yes	4.6	No	No	Yes	No	No			Fair	Some vegetation	0.8	Yes	0
City	1378	Yes	9.2	No	0.5	Yes	No	No	No	No			Good		3.3	Yes	0
City	1379	Yes	5.6	Yes	2.6	No	No	Yes	Yes	No			Fair	Some vegetation	1.9	Yes	0
City	1380	Yes	5.7	Yes	6.3	No	No	Yes	Yes	No			Good		1.9	Yes	0
City	1381	Yes	6.2	Yes	5.0	No	No	Yes	No	No			Good		1.9	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	1382	Yes	6.0	Yes	5.6	No	Yes	No	No	No			Good		3.5	Yes	0
City	1383	Yes	7.9	Yes	0.4	Yes	No	Yes		No		Yes	Good		1.4	Yes	0
City	1384	Yes	8.2	Yes	2.6	No	Yes	Yes	No	No			Fair	Some vegetation	2.0	Yes	0
City	1385	Yes	2.9	Yes	0.8	Yes	Yes	Yes	No	No			Good		2.0	No	0
City	1386	Yes	8.4	No	4.7	No	Yes	No	Yes	No			Poor	Some vegetation	4.7	No	0
City	1387	Yes	4.8	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	2.0	Yes	1
City	1388	Yes	8.4	No	4.1	No	Yes	No	Yes	Yes	Yes	Yes	Good		5.4	Yes	0
City	1389	Yes	1.0	Yes	2.5	No	Yes	No	No	Yes	Yes	Yes	Good		2.5	Yes	0
City	1390	Yes	16.2	No	2.3	No	Yes	Yes	Yes	No			Fair	Some ponding and vegetation	1.9	Yes	0
City	1391	Yes	9.1	No	3.0	No	Yes	No	Yes	Yes	Yes	Yes	Good		4.5	Yes	0
City	1392	Yes	12.3	No	2.1	No	Yes	No	No	Yes	Yes	Yes	Fair	Some vegetation	4.6	Yes	0
City	1393	Yes	4.4	Yes	3.3	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Some vegetation	4.3	Yes	0
City	1394	Yes	9.0	No	6.8	No	Yes	No	No	Yes	Yes	Yes	Good		6.7	Yes	0
City	1395	Yes	2.1	Yes	2.4	No	Yes	Yes	Yes	No			Poor	Driveway	2.0	Yes	0
City	1396	Yes	0.6	Yes	4.9	No	Yes	No	Yes	No			Good	Driveway	4.6	Yes	0
City	1397	Yes	1.1	Yes	0.5	Yes	Yes	Yes	No	No			Good		1.1	Yes	0
City	1398	Yes	2.2	Yes	2.4	No	Yes	Yes	No	No			Good		1.9	Yes	0
City	1399	Yes	11.4	No	2.5	No	Yes	No	No	No	Yes	Yes	Fair	Ponding	3.6	Yes	0
City	1400	Yes	13.7	No	6.4	No	Yes	No	No	No	Yes	Yes	Good	Some cracking	2.3	Yes	0
City	1401	Yes	4.4	Yes	2.8	No	Yes	No		No			Good		4.2	Yes	0
City	1402	Yes	7.4	Yes	0.5	Yes	Yes	Yes	No	No			Good		1.5	Yes	0
City	1403	Yes	8.8	No	1.5	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.8	Yes	0
City	1404	Yes	6.0	Yes	1.6	Yes	Yes	No	Yes	No	Yes	Yes	Good		3.4	Yes	0
City	1405	Yes	6.8	Yes	4.6	No	Yes	No	No	No			Good		5.8	Yes	0
City	1406	Yes	0.2	Yes	0.9	Yes	Yes	Yes	Yes	No			Good		0.9	Yes	0
City	1407	Yes	1.8	Yes	0.5	Yes	Yes	Yes	Yes	No			Good		1.8	Yes	0
City	1408	Yes	6.8	Yes	0.0	Yes	Yes	No	No	No			Good		3.3	Yes	0
City	1409	Yes	7.5	Yes	2.9	No	Yes	No	No	No			Good		3.0	Yes	0
City	1410	Yes	1.9	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
City	1411	Yes	6.3	Yes	1.3	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		2.8	No	0
City	1412	Yes	6.2	Yes	7.5	No	Yes	No	No	No			Fair		2.7	No	0
City	1413	Yes	2.3	Yes	2.1	No	Yes	No	Yes	No			Good		7.5	Yes	0
City	1414	Yes	9.5	No	0.3	Yes	Yes	Yes	Yes	No			Good		1.3	Yes	0
City	1415	Yes	1.4	Yes	1.0	Yes	Yes	Yes		Yes	Yes	Yes	Poor	Truncated domes in wrong location	1.4	Yes	0
City	1416	Yes	9.0	No	1.0	Yes	Yes	Yes		No			Good		1.9	Yes	0
City	1417	Yes	4.6	Yes	2.5	No	Yes	Yes		Yes	Yes	Yes	Good	Truncated domes in wrong location	1.9	Yes	0
City	1418	Yes	9.3	No	1.6	Yes	Yes	No	Yes	No			Good		9.3	Yes	0
City	1419													Under construction			0
City	1420													Under construction			0
City	1421	Yes	7.1	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1422	Yes	5.2	Yes	0.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	No	0
City	1423	Yes	7.8	Yes	0.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.7	Yes	0
City	1424	Yes	1.6	Yes	1.3	Yes	Yes	Yes		Yes	Yes	Yes	Good		1.6	Yes	1
City	1425	Yes	3.4	Yes	3.9	No	Yes	Yes	Yes	No			Fair	Some vegetation	1.8	Yes	0
City	1426	Yes	2.4	Yes	1.3	Yes	Yes	Yes	No	No			Good		0.8	Yes	0
City	1427	Yes	5.6	Yes	0.8	Yes	No	No	No	No			Fair		3.2	No	0
City	1428	Yes	9.8	No	3.0	No	No	No	No	No			Fair	Ponding	3.2	Yes	0
City	1429	Yes	6.8	Yes	0.6	Yes	Yes	Yes	No	No			Good		1.5	Yes	0
City	1430	Yes	10.2	No	5.0	No	Yes	No	No	No			Good		3.4	No	0
City	1431	Yes	11.2	No	4.8	No	Yes	No	No	No			Fair		2.8	No	0
City	1432	Yes	3.5	Yes	6.6	No	No	No	No	No	No	Yes	Poor	Some ponding and vegetation	2.3	Yes	0
City	1433	Yes	7.9	Yes	0.6	Yes	Yes	N/A	No	No			Fair	Some ponding and vegetation	na	Yes	0
City	1434	Yes	4.1	Yes	0.7	Yes	Yes	Yes	Yes	No			Fair	Some vegetation	1.9	Yes	0
City	1435	Yes	4.3	Yes	3.5	No	Yes	Yes	No	No			Fair		1.4	Yes	0
City	1436	Yes	6.8	Yes	1.0	Yes	Yes	Yes	No	No			Fair	Ponding	1.0	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	1437	Yes	0.7	Yes	0.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	0.7	Yes	1
City	1438	Yes	7.3	Yes	1.3	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		4.6	Yes	0
City	1456	Yes	0.5	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.3	Yes	1
City	1580	Yes	2.7	Yes	0.2	Yes	Yes	Yes	No	No			Fair	Ponding	2.0	Yes	0
City	1583	Yes	7.3	Yes	1.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.1	Yes	1
City	1584	Yes	2.5	Yes	1.8	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.7	Yes	1
City	1629	Yes	14.3	No	0.1	Yes	Yes	No	Yes	No			Good	28.6 to initially get up	14.3	Yes	0
City	1630	Yes	4.1	Yes	0.8		Yes	Yes	Yes	No			Fair		0.8	No	0
City	1631	Yes	14.3	No	1.9	Yes	No	No	No	No			Good		3.0	Yes	0
City	1632	Yes	5.6	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
City	1633	Yes	4.2	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	1
City	1634	Yes	1.4	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
City	1635	Yes	3.3	Yes	6.3	No	Yes	No	Yes	No	Yes	Yes	Good		4.5	Yes	0
City	1636	Yes	1.5	Yes	7.2	No	Yes	No	Yes	No	Yes	Yes	Good		3.4	Yes	0
City	1637	Yes	2.8	Yes	4.2	No	Yes	No	No	No	Yes	Yes	Fair	Some vegetation	3.6	Yes	0
City	1638	Yes	0.2	Yes	1.8	Yes		Yes	No	No	Yes	Yes	Good		1.8	Yes	0
City	1639	Yes	6.0	Yes	3.2	No	Yes	No	No	No	No	Yes	Fair		5.7	Yes	0
City	1640	Yes	1.2	Yes	3.7	No	Yes	Yes	Yes	No	Yes	Yes	Fair	Some vegetation	1.4	Yes	0
City	1641	Yes	1.4	Yes	5.2	No	Yes	No	Yes	No	Yes	Yes	Fair		3.1	No	0
City	1642	Yes	3.1	Yes	2.1	No	Yes	No		No	Yes	Yes	Fair	ponding, no flares	3.8	Yes	0
City	1643	Yes	2.7	Yes	7.8	No	Yes	Yes	Yes	No	Yes	Yes	Good		1.9	Yes	0
City	1644	Yes	2.3	Yes	1.5	Yes	Yes	Yes		No	No	Yes	Poor	ponding, no flares	1.4	Yes	0
City	1645	Yes	3.2	Yes	0.6	Yes	Yes	No	Yes	No	Yes	Yes	Fair	ponding no flares	3.3	Yes	0
City	1650	Yes	11.2	No	0.0	Yes	Yes	No	No	No			Good		7.2	Yes	0
City	1651	Yes	5.6	Yes	2.1	No	Yes	No	Yes	No			Good		2.2	Yes	0
City	1652	Yes	4.9	Yes	4.7	No	Yes	No	No	No			Good		4.0	Yes	0
City	1653	Yes	10.8	No	8.0	No	Yes	No	No	No			Good		4.7	Yes	0
City	1654	Yes	6.3	Yes	1.7	Yes	Yes	No	No	No			Good		3.3	Yes	0
City	1655	Yes	6.3	Yes	2.1	No	Yes	Yes	No	No			Good		1.1	Yes	0
City	1656	Yes	7.2	Yes	1.5	Yes	Yes	No	No	No			Good		4.5	Yes	0
City	1657	Yes	5.0	Yes	0.7	Yes	Yes	No	No	No			Good		3.7	Yes	0
City	1658	Yes	3.2	Yes	3.9	No	Yes	No	No	No			Good		2.3	Yes	0
City	1659	Yes	1.5	Yes	5.0	No	Yes	No	No	No			Good		3.6	Yes	0
City	1660	Yes	0.3	Yes	2.4	No	Yes	No	Yes	Yes	Yes	Yes	Good		2.9	Yes	0
City	1761	Yes	0.8	Yes	11.7	No	Yes	No	No	No			Good		4.3	Yes	0
City	1762	Yes	5.1	Yes	7.3	No	Yes	No	No	No			Good		4.0	Yes	0
City	1763	Yes	8.1	Yes	2.1	No	Yes	No	No	No			Good		2.8	Yes	0
City	1764	Yes	10.0	No	2.0	Yes	Yes	No	No	No			Fair		5.0	No	0
City	1765	Yes	3.9	Yes	5.9	No	Yes	No	No	Yes	Yes	Yes	Good		2.2	Yes	0
City	1766	Yes	0.5	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.4	Yes	1
City	1767	Yes	8.8	No	2.1	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.7	Yes	0
City	1768	Yes	8.7	No	5.1	No	Yes	No	No	Yes	Yes	Yes	Fair	Some vegetation	4.4	Yes	0
City	1789	Yes	1.5	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
City	1790	Yes	5.6	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.7	Yes	0
City	1796	Yes	2.2	Yes	1.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	1
City	1797	Yes	2.0	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
City	1798	Yes	1.9	Yes	1.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	0
City	1799	Yes	5.0	Yes	2.2	No	Yes	Yes	No	No			Good		2.0	Yes	0
City	1800	Yes	6.7	Yes	0.5	Yes	Yes	Yes	No	No			Good		1.7	Yes	0
City	1801	Yes	6.9	Yes	0.9	Yes	Yes	Yes	No	No			Good		1.8	Yes	0
City	1802	Yes	6.3	Yes	0.5	Yes	Yes	Yes	No	No			Good		1.9	Yes	0
City	1803	Yes	7.2	Yes	1.4	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
City	1804	Yes	4.6	Yes	2.5	No	Yes	No	No	No			Good		3.8	Yes	0
City	1805	Yes	14.2	No	0.5	Yes	No	No	No	No			Fair	Ponding	2.7	Yes	0
City	1806	Yes	13.9	No	0.3	Yes	No	Yes	No	No			Fair	Some ponding and vegetation	1.4	Yes	0
City	1807	Yes	12.5	No	2.9	No	No	Yes	No	No			Fair	Some vegetation	1.4	Yes	0
City	1808	Yes	11.8	No	0.9	Yes	No	Yes	No	No			Fair	Some vegetation	1.6	Yes	0
City	1809	Yes	1.5	Yes	0.9	Yes	Yes	Yes	No	No			Good		1.5	Yes	0
City	1810	Yes	4.9	Yes	1.0	Yes	Yes	Yes	No	No			Good		1.9	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	1811	Yes	5.1	Yes	0.9	Yes	Yes	Yes	No	No			Fair	Some vegetation	1.9	Yes	0
City	1812	Yes	5.3	Yes	2.0	Yes	Yes	Yes	No	No			Fair	Some ponding and vegetation	1.8	Yes	0
City	1813	Yes	9.6	No	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
City	1814	Yes	12.3	No	0.2	Yes	Yes	Yes	Yes	No			Good		1.9	Yes	0
City	1815	Yes	7.4	Yes	0.0	Yes	Yes	No	No	No			Fair	Ponding	6.3	Yes	0
City	1816	Yes	4.4	Yes	0.4	Yes	Yes	Yes	No	No			Fair	Ponding	1.0	Yes	0
City	1871	Yes	1.3	Yes	4.5	No	Yes	Yes	No	No			Good		1.9	Yes	0
City	1872	Yes	0.2	Yes	5.0	No	Yes	Yes	No	No			Good		1.8	Yes	0
City	1873	Yes	2.5	Yes	0.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
City	1874	Yes	3.0	Yes	0.4	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		2.4	Yes	0
City	1875	Yes	2.8	Yes	4.4	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
City	1876	Yes	2.1	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
City	1877	Yes	8.7	No	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
City	1878	Yes	7.7	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
City	1879	Yes	3.1	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.3	Yes	1
City	1880	Yes	4.6	Yes	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1881	Yes	6.8	Yes	2.6	No	Yes	Yes	No	Yes	Yes	Yes	Fair	Obstruction	2.0	Yes	0
City	1882	Yes	7.9	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Poor	Obstruction	1.5	Yes	0
City	1883	Yes	1.6	Yes	2.8	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
City	1884	Yes	7.0	Yes	0.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.6	Yes	0
City	1885	Yes	6.8	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
City	1886	Yes	2.9	Yes	2.7	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	0
City	1893	Yes	9.6	No	0.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		9.3	Yes	0
City	1894	Yes	7.4	Yes	2.9	No	Yes	No	No	Yes	Yes	Yes	Good		7.8	Yes	0
City	1895	Yes	17.0	No	6.7	No	Yes	No	No	Yes	Yes	Yes	Good		13.4	Yes	0
City	1896	Yes	7.7	Yes	1.1	Yes	Yes	No	No	Yes	Yes	Yes	Fair		7.5	Yes	0
City	1897	Yes	3.3	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1898	Yes	4.1	Yes	1.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	1
City	1899	Yes	6.0	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
City	1900	Yes	1.8	Yes	4.5	No	Yes	No	No	Yes	Yes	Yes	Good		2.5	Yes	0
City	1901	Yes	5.6	Yes	2.6	No	Yes	Yes	No	No			Good		0.5	Yes	0
City	1902	Yes	5.6	Yes	0.1	Yes	Yes	No	No	No			Good		3.0	Yes	0
City	1903	Yes	8.1	Yes	2.8	No	Yes	No	No	Yes	Yes	Yes	Good		8.6	Yes	0
City	1904	Yes	3.9	Yes	1.6	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		2.6	Yes	0
City	1907	Yes	7.5	Yes	1.4	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.1	Yes	0
City	1908	Yes	1.0	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1909	Yes	4.4	Yes	1.7	Yes	Yes	No	No	No			Good		3.0	Yes	0
City	1910	Yes	0.7	Yes	1.0	Yes	Yes	Yes	No	No			Good		1.0	Yes	0
City	1911	Yes	0.2	Yes	1.7	Yes	Yes	Yes	No	No			Good		1.7	Yes	0
City	1912	Yes	0.3	Yes	1.7	Yes	Yes	Yes	Yes	No			Good		1.7	Yes	0
City	1913	Yes	4.8	Yes	2.2	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
City	1914	Yes	4.2	Yes	2.3	No	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
City	1915	Yes	6.9	Yes	3.3	No	Yes	No	No	Yes	Yes	Yes	Good		2.9	Yes	0
City	1916	Yes	6.5	Yes	1.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1917	Yes	0.5	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
City	1918	Yes	0.6	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	1923	Yes	6.8	Yes	3.3	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Ponding	3.4	Yes	0
City	1934	Yes	1.1	Yes	3.0	No	Yes	No	No	No			Good		3.0	Yes	0
City	1935	Yes	1.8	Yes	3.2	No	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
City	1936	Yes	6.0	Yes	0.2	Yes	Yes	Yes	No	No			Good		0.9	Yes	0
City	1937	Yes	3.9	Yes	0.8	Yes	Yes	No	No	No			Good		3.1	Yes	0
City	1938	Yes	1.4	Yes	2.6	No	Yes	Yes	No	No			Fair	Ponding	2.0	No	0
City	1939	Yes	4.3	Yes	0.1	Yes	Yes	No	No	No			Good		2.4	Yes	0
City	1940	Yes	4.5	Yes	1.0	Yes	Yes	Yes	No	No			Good		1.5	Yes	0
City	1941	Yes	1.9	Yes	3.4	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
City	1942	Yes	0.2	Yes	3.0	No	Yes	No	No	No			Good		2.4	Yes	0
City	1943	Yes	6.2	Yes	1.6	Yes	Yes	No	No	No			Good		2.7	Yes	0
City	1944	Yes	0.8	Yes	1.2	Yes	Yes	Yes	No	No			Good		1.2	Yes	0
City	1945	Yes	3.8	Yes	2.3	No	Yes	No	No	No			Good		3.0	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	1946	Yes	1.1	Yes	2.9	No	Yes	Yes	No	No			Good		1.4	Yes	0
City	1947	Yes	7.6	Yes	0.7	Yes	Yes	Yes	No	No			Good		0.5	Yes	0
City	1948	Yes	6.3	Yes	1.9	Yes	Yes	Yes	Yes	No			Good		1.3	No	0
City	1949	Yes	5.3	Yes	0.8	Yes	Yes	No	No	No			Good		2.9	Yes	0
City	1950	Yes	7.5	Yes	1.8	Yes	Yes	Yes		No			Good	Driveway	1.4	Yes	0
City	1951	Yes	0.4	Yes	1.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
City	1952	Yes	1.1	Yes	7.7	No	Yes	No	No	No			Good		7.4	Yes	0
City	1960	Yes	6.2	Yes	3.8	No	Yes	No	Yes	No			Good		4.2	Yes	0
City	2006	Yes	3.7	Yes	0.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.6	Yes	0
City	2007	Yes	1.8	Yes	2.4	No	Yes	No	No	Yes	Yes	Yes	Good		2.3	Yes	0
City	2008	Yes	7.9	Yes	0.2	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.4	Yes	0
City	2009	Yes	0.3	Yes	3.8	No	Yes	No	No	No			Good		2.6	Yes	0
City	2010	Yes	0.6	Yes	0.7	Yes	Yes	Yes	No	No			Good		0.7	Yes	0
City	2011	Yes	2.2	Yes	2.8	No	Yes	No	Yes	No			Good		2.7	Yes	0
City	2012	Yes	1.2	Yes	0.5	Yes	Yes	Yes	No	No	Yes	Yes			1.2		0
City	2013	Yes	2.6	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0
City	2014	Yes	6.0	Yes	2.2	No	Yes	No	No	Yes	Yes	Yes	Fair		3.3	Yes	0
City	2015	Yes	7.0	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation	0.7	Yes	0
City	2016	Yes	0.9	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	0.7	Yes	0
City	2019	Yes	13.4	No	1.2	Yes	Yes	Yes	No	No			Good		1.8	Yes	0
City	2020	Yes	4.7	Yes	3.9	No	Yes	Yes	No	No			Good		1.4	Yes	0
City	2021	Yes	8.6	No	2.4	No	Yes	No	No	No			Good		2.6	Yes	0
City	2022	Yes	2.7	Yes	6.7	No	Yes	No	Yes	No			Good		3.9	Yes	0
City	2023	Yes	4.1	Yes	6.8	No	Yes	No	No	No			Fair	Some vegetation	6.1	Yes	0
City	2024	Yes	6.0	Yes	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	2025	Yes	0.2	Yes	0.5	Yes	Yes	Yes	No	No			Fair	Ponding	0.5	Yes	0
City	2026	Yes	1.7	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
City	2028	Yes	9.3	No	0.6	Yes	Yes	No	No	No			Good		3.6	Yes	0
City	2029	Yes	8.0	Yes	0.7	Yes	Yes	Yes	No	No			Good		1.9	Yes	0
City	2030	Yes	11.3	No	0.7	Yes	Yes	No	No	No			Good		3.0	Yes	0
City	2031	Yes	9.2	No	1.0	Yes	Yes	No	No	No			Good		2.8	Yes	0
City	2032	Yes	3.8	Yes	0.5	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.3	Yes	0
City	2033	Yes	2.5	Yes	3.0	No	Yes	No	No	No			Good		4.4	Yes	0
City	2034	Yes	2.9	Yes	0.2	Yes	Yes	No	No	No			Fair	Ponding	3.2	Yes	0
City	2035	Yes	5.0	Yes	2.3	No	Yes	Yes	Yes	No			Good		1.8	Yes	0
City	2036	Yes	9.6	No	0.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	0
City	2037	Yes	7.5	Yes	1.4	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		4.2	Yes	0
City	2038	Yes	11.2	No	1.5	Yes	Yes	Yes	Yes	No			Good		1.8	Yes	0
City	2039	Yes	4.7	Yes	2.6	No	Yes	No	Yes	No			Good		3.6	Yes	0
City	2040	Yes	4.4	Yes	3.5	No	Yes	No	No	No			Good		2.8	Yes	0
City	2041	Yes	11.1	No	2.8	No	Yes	No	No	No			Good		6.7	Yes	0
City	2042	Yes	7.7	Yes	3.3	No	Yes	No	No	No			Good		2.8	Yes	0
City	2043	Yes	5.1	Yes	5.7	No	Yes	Yes	Yes	No			Good		1.6	Yes	0
City	2061	Yes	3.4	Yes	2.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	0
City	2062	Yes	2.9	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
City	2063	Yes	2.2	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.4	Yes	0
City	2064	Yes	3.3	Yes	1.4	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Some ponding	2.6	Yes	0
City	2065	Yes	5.8	Yes	0.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
City	2066	Yes	3.8	Yes	4.7	No	Yes	No	No	Yes	Yes	Yes	Good		3.3	Yes	0
City	2067	Yes	5.0	Yes	11.3	No	Yes	No	No	No			Good		3.1	Yes	0
City	2068	Yes	4.1	Yes	8.3	No	Yes	Yes	No	No			Good		0.8	Yes	0
City	2069	Yes	4.5	Yes	9.4	No	Yes	Yes	No	No			Fair	Some cracking	0.3	Yes	0
City	2070	Yes	3.1	Yes	8.1	No	Yes	No	No	No			Good		3.4	Yes	0
City	2071	Yes	5.1	Yes	9.6	No	Yes	No	No	No			Good		2.2	Yes	0
City	2072	Yes	5.2	Yes	8.3	No	Yes	No	No	No			Good		4.3	Yes	0
City	2073	Yes	4.7	Yes	7.7	No	Yes	No	No	No			Good		2.9	Yes	0
City	2074	Yes	4.0	Yes	6.1	No	Yes	No	No	No			Good		2.9	Yes	0
City	2075	Yes	6.0	Yes	7.9	No	Yes	Yes	No	No			Good		1.7	Yes	0
City	2076	Yes	3.5	Yes	7.0	No	Yes	Yes	No	No			Good		1.3	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	2077	Yes	5.9	Yes	7.8	No	Yes	No		No			Good	No flares	2.4	Yes	0
City	2078	Yes	5.0	Yes	9.5	No	Yes	No	No	No			Good		4.7	Yes	0
City	2079	Yes	6.9	Yes	8.7	No	Yes	No	No	No			Good		2.4	Yes	0
City	2080	Yes	1.3	Yes	7.1	No	Yes	No	No	No			Good		2.6	Yes	0
City	2081	Yes	6.5	Yes	8.1	No	Yes	No	No	No			Good		3.4	Yes	0
City	2082	Yes	6.3	Yes	7.7	No	Yes	No	No	No			Good		3.6	Yes	0
City	2083	Yes	5.5	Yes	2.7	No	Yes	No	No	No			Good		3.6	Yes	0
City	2084	Yes	4.4	Yes	7.5	No	Yes	No	No	No			Good		3.4	Yes	0
City	2085	Yes	5.8	Yes	6.8	No	Yes	No		No	No		Good	No flares	3.4	Yes	0
City	2086	Yes	5.2	Yes	7.6	No	Yes	No		No	No		Good	No flares	2.2	Yes	0
City	2087	Yes	11.9	No	3.5	No	Yes	Yes	No	No			Fair	Some vegetation	1.8	Yes	0
City	2088	Yes	4.2	Yes	0.8	Yes	Yes	Yes	Yes	No			Good		2.0	Yes	0
City	2089	Yes	3.2	Yes	0.3	Yes	Yes	Yes		No			Fair	No flares	1.9	No	0
City	2110	Yes	2.5	Yes	4.8	No	Yes	Yes	No	No			Good		1.6	No	0
City	2111	Yes	1.9	Yes	0.4	Yes	Yes	Yes	Yes	No			Good		1.9	Yes	0
City	2112	Yes	1.2	Yes	0.1	Yes	Yes	Yes	No	No			Good		1.2	Yes	0
City	2113	Yes	2.5	Yes	2.2	No	Yes	Yes	No	No			Good		0.4	Yes	0
City	2114	Yes	4.8	Yes	4.0	No	Yes	Yes	No	No			Good		1.6	Yes	0
City	2115	Yes	4.8	Yes	2.8	No	Yes	Yes	No	No			Good		2.0	Yes	0
City	2116	Yes	7.3	Yes	2.2	No	Yes	Yes	No	No			Good		1.9	Yes	0
City	2117	Yes	7.4	Yes	1.9	Yes	Yes	Yes	No	No			Poor	Ponding	1.6	Yes	0
City	2130	Yes	4.1	Yes	3.7	No	Yes	No	Yes	No			Fair	Vegetation on sewer	4.1	Yes	0
City	2131	Yes	4.7	Yes	3.3	No	Yes	No	No	No			Good		4.6	Yes	0
City	2132	Yes	11.8	No	1.9	Yes	Yes	No	No	No			Fair	Vegetation on flares	3.9	Yes	0
City	2133	Yes	6.7	Yes	0.7	Yes	Yes		No	No			Poor	Under construction	na	No	0
City	2134	Yes	5.6	Yes	6.1	No	Yes	No	No	No			Fair	Vegetation on flares	2.7	Yes	0
City	2135													Under construction			0
City	2136													Under construction			0
City	2137	Yes	3.7	Yes	2.8	No	Yes	No	No	No			Poor	Gap up to landing	6.3	No	0
City	2138	Yes	1.6	Yes	1.2	Yes	Yes	Yes	No	No			Fair		1.6	No	0
City	2139	Yes	14.5	No	0.4	Yes	Yes	Yes	No	No			Fair	Some vegetation	1.2	Yes	0
City	2140	Yes	4.1	Yes	0.5	Yes	Yes	No	No	No			Good		5.5	Yes	0
City	2141	Yes	1.7	Yes	0.8	Yes	Yes	Yes	Yes	No			Good		1.7	Yes	0
City	2142	Yes	3.3	Yes	1.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
City	2143	Yes	9.0	No	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.7	Yes	0
City	2144	Yes	1.0	Yes	4.5	No	Yes	No		No			Good	No flares	5.2	Yes	0
City	2145	Yes	0.7	Yes	3.8	No	Yes	No		No	Yes		Good	No flares	3.6	Yes	0
City	2146	Yes	7.1	Yes	0.2	Yes	Yes	No	No	No			Good		7.1	Yes	0
City	2147	Yes	6.8	Yes	2.0	Yes	Yes	Yes		No			Good	No flares	0.9	Yes	0
City	2148	Yes	8.2	Yes	3.0	No	Yes	Yes	No	No			Fair	Some vegetation	1.0	Yes	0
City	2149	Yes	10.7	No	2.7	No	Yes	No	No	No			Good		4.2	Yes	0
City	2150	Yes	0.7	Yes	0.5	Yes	Yes	Yes	No	No			Good		0.7	Yes	0
City	2151	Yes	6.8	Yes	0.3	Yes	Yes	No	No	No			Poor	Ponding	5.4	Yes	0
City	2152													Under construction			0
City	2153	Yes												Under construction			0
City	2161	Yes												Under construction			0
City	2162	Yes	14.2	No	8.4	No	Yes	No	No	Yes	Yes	Yes	Good	Under construction	11.6	Yes	0
City	2163	Yes	2.6	Yes	5.7	No	Yes	No	No	Yes	Yes	Yes	Good		3.0	Yes	0
City	2164	Yes	9.6	No	6.4	No	Yes	No	No	Yes	Yes	Yes	Good		3.8	Yes	0
City	2165													Under construction			0
City	2166	Yes	5.6	Yes	4.7	No	Yes	No	No	Yes	Yes	Yes	Good		2.2	Yes	0
City	2167	Yes	4.0	Yes	1.1	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		3.8	Yes	0
City	2168	Yes	9.6	No	1.3	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Ponding	2.9	Yes	0
City	2169	Yes	7.1	Yes	2.8	No	Yes	No	No	Yes	Yes	Yes	Good		2.3	Yes	0
City	2170	Yes	3.3	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding	1.4	Yes	0
City	2171	Yes	6.8	Yes	6.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
City	2172	Yes	7.4	Yes	4.8	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
City	2173	Yes	4.7	Yes	6.5	No	Yes	No	No	Yes	Yes	Yes	Good		4.2	Yes	0
City	2174	Yes	3.5	Yes	7.0	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
City	2175	Yes	8.2	Yes	4.6	No	Yes	No	No	Yes	Yes	Yes	Good		5.1	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
City	2176	Yes	1.1	Yes	4.1	No	Yes	N/A	No	Yes	Yes	Yes	Good		construction	Yes	0
City	2177													Under construction			0
City	2178	Yes	10.7	No	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.7	Yes	0
City	2179	Yes	6.4	Yes	1.0	Yes	Yes	N/A	Yes	No			Good	Under construction	Under construction	Yes	0
City	2180	Yes	5.6	Yes	0.5	Yes	Yes	No	No	No			Good		4.9	Yes	0
City	2181	Yes	5.0	Yes	4.6	No	Yes	No	No	No	Yes		Good		4.6	Yes	0
City	2182	Yes	13.5	No	5.5	No	Yes	No	No	No			Good		6.2	Yes	0
City	2183	Yes	7.4	Yes	1.7	Yes	Yes	No	No	No			Good		5.1	Yes	0
City	2184	Yes	9.7	No	2.5	No	Yes	N/A	No	No			Fair	Some cracking and under construction	na	No	0
City	2185	Yes	4.1	Yes	4.6	No	Yes	No	No	No			Good		6.2	Yes	0
City	2186													Under construction			0
City	2187	Yes	6.8	Yes	4.5	No	Yes	No	No	No			Good		2.6	Yes	0
City	2188	Yes	4.3	Yes	0.0	Yes	Yes	No	No	No			Good	sewer in ramp	3.2	Yes	0
City	2189													Under construction			0
City	2191	Yes	10.8	No	0.9	Yes	Yes	No	No	No			Fair	Ponding	8.7	Yes	0
City	2192													Under construction			0
City	2193	Yes	10.7	No	0.1	Yes	Yes	No	No	No			Good		5.2	Yes	0
City	2194	Yes	6.5	Yes	2.9	No	Yes	No	No	No			Good		2.4	Yes	0
City	2195	Yes	8.2	Yes	1.4	Yes	Yes	No	No	No			Good		5.0	Yes	0
City	2196	Yes	5.4	Yes	3.2	No	Yes	N/A	No	No			Fair	Under construction	na	Yes	0
City	2197	Yes	8.2	Yes	7.5	No	Yes	No	No	No			Good		5.5	Yes	0
City	2198	Yes	1.4	Yes	8.0	No	Yes	N/A	No	No		No	Good	Under construction	na	Yes	0
City	2199	Yes		Yes										Under construction			0
City	2200	Yes	2.0	Yes	3.6	No	Yes	No	No	No			Good		4.5	Yes	0
City	2201	Yes	4.9	Yes	2.1	No	Yes	No	Yes	No			Good		2.5	Yes	0
City	2202	Yes	0.8	Yes	5.7	No	Yes	Yes	Yes	No			Good		0.8	Yes	0
City	2203	Yes	7.3	Yes	0.6	Yes	Yes	Yes	Yes	No			Good		1.9	Yes	0
City	2204	Yes	6.9	Yes	0.1	Yes	Yes	Yes	Yes	No			Fair	Some vegetation	1.7	Yes	0
City	2205	Yes	2.6	Yes	5.5	No	Yes	No	No	No			Fair	Some vegetation	2.4	Yes	0
City	2206	Yes	7.9	Yes	5.6	No	Yes	No	No	No			Poor		7.9	Yes	0

CITY-OWNED:	536
# Compliant:	27
% Compliant:	5%

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	2	Yes	Yes		N/A		No	No	Good		No		10.7	3.1	0
City	3	Yes	Yes				Yes	No	Good		Yes		1.1	6	0
City	4	Yes	Yes				Yes	Yes	Good		Yes		0.9	1.3	1
City	5	Yes	Yes				Yes	No	Good		No		0.6	2.1	0
City	6	Yes	Yes				Yes	No	Good		Yes		0.3	3.2	0
City	7	Yes	Yes				No	No	Good		Yes		0.8	2.4	0
City	8	Yes	Yes				Yes	No	Good		Yes		4.6	2.7	0
City	9	Yes	Yes				Yes	No	Good		Yes		1.5	2.7	0
City	10	Yes	Yes				Yes	No	Good		Yes		1.0	2.6	0
City	11	Yes	Yes				Yes	No	Good		Yes		0.2	2.7	0
City	12	Yes	Yes				Yes	No	Good		Yes		1.4	2.4	0
City	13	Yes	Yes				Yes	Yes	Good		Yes		1.1	1.4	1
City	14	Yes	Yes				Yes	No	Good		Yes		0.3	2.1	0
City	15	Yes	Yes				Yes	Yes	Good		No	Ponding	0.4	1.9	0
City	16	Yes	Yes				Yes	Yes	Good		Yes		1.7	1.5	1
City	17	Yes	Yes				No	Yes	Good		Yes		12.3	0.6	0
City	18	Yes	Yes				Yes	No	Good		Yes		1.1	2.4	0
City	19	Yes	Yes				Yes	Yes	Good		Yes		1.2	2.0	1
City	20	Yes	Yes				Yes	No	Good		Yes		0.1	2.3	0
City	21	Yes	Yes				Yes	No	Good		Yes		2.3	2.2	0
City	22	Yes	Yes				Yes	Yes	Good		Yes		0.8	1.4	1
City	23	Yes	Yes				Yes	Yes	Good		Yes		1.0	1.9	1
City	24	Yes	Yes				No	No	Fair		Yes	Ponding	5.7	12.5	0
City	25	Yes	Yes				No	No	Fair			Ponding	6.5	3.8	0
City	26	Yes	Yes				Yes	Yes	Good		Yes		0.0	1.4	1
City	27	Yes	Yes				Yes	Yes	Good		Yes		3.1	0.7	1
City	29	Yes	Yes				Yes	Yes	Good		No		1.0	0.2	0
City	30	Yes	Yes				Yes	No	Good		Yes	Ponding	1.1	2.1	0
City	31	Yes	Yes				Yes	Yes	Good		Yes		1.3	1.1	1
City	32	Yes	Yes				Yes	Yes	Good		Yes		1.5	1.0	1
City	33	Yes	Yes				Yes	No	Good		Yes		0.9	3.1	0
City	34	Yes	Yes				Yes	No	Good		Yes		2	3.0	0
City	35	Yes	Yes				Yes	No	Good		Yes		1.9	2.6	0
City	36	Yes	Yes				Yes	No	Good		Yes		1.5	3.0	0
City	37	Yes	Yes				Yes	No	Good	Pavement damage	Yes		0.6	2.2	0
City	38	Yes	Yes				Yes	No	Good		Yes		0.9	2.6	0
City	39	Yes	Yes				Yes	Yes	Good		Yes		1.2	1.2	1
City	40	Yes	Yes				Yes	Yes	Good		Yes		1.6	0.6	1
City	41	Yes	Yes				Yes	Yes	Good	Ponding	Yes		1.7	1.3	1
City	42	Yes	Yes				Yes	Yes	Good		Yes		0.4	1.5	1
City	43	Yes	Yes				Yes	Yes	Good		Yes		1.1	0.0	1
City	44	Yes	Yes				Yes	Yes	Good		Yes		1.6	0.8	1
City	45	Yes	Yes				Yes	Yes	Good		Yes		0.9	1.1	1
City	46	Yes	Yes				Yes	Yes	Good		Yes		0.3	1.4	1
City	47	Yes	Yes				Yes	Yes					0.6	0.7	1
City	48	Yes	Yes				Yes	Yes	Good		Yes	Ponding	0.3	0.5	1
City	49	Yes	Yes				Yes	Yes	Good		Yes		0.0	1.8	1
City	50	Yes	Yes				Yes	Yes	Good		Yes		1.0	1.1	1
City	51	Yes	Yes				Yes	Yes	Good		Yes		1.6	1.7	1
City	52	Yes	Yes				No	No	Good		Yes		9.0	2.3	0
City	53	Yes	Yes				Yes	Yes	Good		Yes		1.6	0.4	1
City	54	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.6	1
City	55	Yes	Yes				Yes	No	Good		Yes		0.5	2.9	0
City	56	Yes	Yes				Yes	No	Fair		Yes		4.3	3.7	0
City	57	Yes	Yes				Yes	Yes	Good		Yes		4.6	1.6	1
City	58	Yes	Yes				Yes	No	Good		Yes		1.0	3.5	0
City	59	Yes	Yes				Yes	Yes	Good		Yes		4.3	1.2	1
City	60	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.8	1
City	61	Yes	Yes				Yes	No	Good		Yes	Ponding	0.7	2.4	0
City	62	Yes	Yes				Yes	Yes	Good		Yes		0.7	0.9	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	63	Yes	Yes				Yes	Yes	Good		Yes		0.8	1.8	1
City	64	Yes	Yes				Yes	Yes	Good		Yes		0.0	0.9	1
City	65	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.8	1
City	66	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.7	1
City	67	Yes	Yes				Yes	Yes	Good		Yes		1.1	1.7	1
City	68	Yes	Yes				Yes	Yes	Good		Yes		0.4	1.5	1
City	69	Yes	Yes				Yes	Yes	Good		Yes		0.5	1.2	1
City	70	Yes	Yes				Yes	No	Good		Yes		0.7	2.7	0
City	71	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.8	1
City	72	Yes	Yes				Yes	Yes	Good		Yes		0.2	1.9	1
City	73	Yes	Yes				Yes	No	Good		Yes		0.3	3.3	0
City	74	Yes	Yes				Yes	No	Good		Yes		0.2	2.6	0
City	77	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.2	1
City	78	Yes	Yes				Yes	Yes	Good		Yes		2.0	0.9	1
City	79	Yes	Yes				Yes	Yes	Good		Yes		1.6	1.2	1
City	80	Yes	Yes				Yes	Yes	Good		Yes		4.1	1.5	1
City	81	Yes	Yes				Yes	No	Good		Yes		2.9	3.2	0
City	82	Yes	Yes				No	Yes	Good		Yes		7.5	0.3	0
City	83	Yes	Yes				Yes	No	Good		Yes		0.4	3.4	0
City	84	Yes	Yes				Yes	No	Poor	Some ponding and vegetation	Yes	Ponding	0.8	3.2	0
City	85	Yes	Yes				Yes	No	Good		Yes		2.2	4.1	0
City	86	Yes	Yes				Yes	No	Poor	giant pothole	Yes		1.4	2.3	0
City	87	Yes	Yes				Yes	No	Good		Yes		0.3	4.0	0
City	88	Yes	Yes				Yes	Yes	Good		Yes		0.8	0.6	1
City	89	Yes	Yes				Yes	Yes	Good		Yes		2.4	0.6	1
City	90	Yes	Yes				No	Yes	Poor	large gaps on bridge. no handrails	No		7.0	1.0	0
City	91	Yes	Yes				Yes	Yes	Good		Yes		1.8	2.0	1
City	92	Yes	Yes				Yes	No	Good		Yes		0.8	4.3	0
City	93	Yes	Yes				Yes	Yes	Good		Yes		3.6	1.0	1
City	94	Yes	Yes				Yes	Yes	Good		Yes		2.5	1.5	1
City	95	Yes	Yes				Yes	Yes	Good		Yes		0.3	1.2	1
City	96	Yes	Yes				No	No	Good		Yes	Ponding	5.1	3.0	0
City	97	Yes	Yes				Yes	Yes	Good		Yes		3.6	0.6	1
City	98	Yes	Yes				Yes	Yes	Good		Yes		2.8	1.2	1
City	99	Yes	Yes				Yes	No	Good		Yes		0.3	3.4	0
City	104	Yes	Yes				Yes	Yes	Good		Yes		1.2	0.6	1
City	105	Yes	Yes				Yes	Yes	Fair		Yes		1.7	1.9	1
City	113	Yes	Yes				Yes	Yes	Fair		Yes	Ponding	1.4	0.5	1
City	114	Yes	Yes				Yes	Yes	Good		Yes		0.9	1.4	1
City	115	Yes	Yes				Yes	Yes	Good		Yes		3.5	0.6	1
City	116	Yes	Yes				Yes	No	Good		Yes		0.7	3.1	0
City	117	Yes	Yes				Yes	No	Good		Yes		0.3	2.4	0
City	118	Yes	Yes				Yes	No	Good		Yes		1.3	2.4	0
City	119	Yes	Yes				Yes	No	Poor		No		3.4	3.5	0
City	120	Yes	Yes				Yes	Yes	Good		Yes		0.6	1.7	1
City	121	Yes	Yes				Yes	Yes	Fair		Yes	Ponding	0.8	0.0	1
City	122	Yes	Yes				Yes	No	Good		Yes		3.2	3.3	0
City	123	Yes	Yes				Yes	No	Good		Yes		1.6	3.7	0
City	124	Yes	Yes				Yes	No	Good		Yes		1.4	4.3	0
City	125	Yes	Yes				Yes	No	Good		Yes		0.4	2.6	0
City	126	Yes	Yes				Yes	Yes	Good		Yes		0.2	0.9	1
City	127	Yes	Yes				Yes	Yes	Poor		Yes		1.7	0.7	0
City	128	Yes	Yes				Yes	Yes	Good		Yes		4.3	1.5	1
City	129	Yes	Yes				Yes	Yes	Good		Yes		0.9	0.8	1
City	131	Yes	Yes				Yes	No	Good		Yes		4.1	4.0	0
City	132	Yes	Yes				Yes	Yes	Good		Yes		0.4	0.7	1
City	133	Yes	Yes				Yes	No	Good		Yes		2.7	2.5	0
City	134	Yes	Yes				Yes	No	Good		Yes		2.6	0.4	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	135	Yes	Yes				No	No	Good		Yes		5.3	2.6	0
City	136	Yes	Yes				Yes	No	Good		Yes		1.1	2.9	0
City	137	Yes	Yes				No	Yes	Good		Yes		6.0	1.9	0
City	138	Yes	Yes				Yes	Yes	Good		Yes		0.5	1.3	1
City	139	Yes	Yes				No	Yes	Good		Yes		10.7	1.4	0
City	140	Yes	Yes				Yes	Yes	Good		Yes		0.5	0.9	1
City	141	Yes	Yes				Yes	No	Good		Yes		0.7	3.3	0
City	142	Yes	Yes				Yes	No	Fair		Yes		3.4	2.6	0
City	143	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.3	1
City	144	Yes	Yes	Yes			Yes	Yes	Good		Yes		1.9	0.5	1
City	145	Yes	Yes				No	Yes	Poor	roots under pavement	No		5.2	1.8	0
City	146	Yes	Yes				No	Yes	Good		Yes		10.5	0.6	0
City	147	Yes	Yes				Yes	Yes					0.3	1.2	1
City	148	Yes	Yes				Yes	Yes	Good		Yes		3.7	0.1	1
City	149	Yes	Yes				Yes	Yes	Good		Yes		1.6	0.5	1
City	150	Yes	Yes				Yes	Yes	Good		Yes		0.5	0.9	1
City	151	Yes	Yes				No	No	Good		Yes		14.7	2.1	0
City	152	Yes	Yes				Yes	Yes	Poor	bumps from culverts. no prevention from going off side	Yes		5.0	1.1	0
City	153	Yes	Yes				No	Yes					6.7	1.0	0
City	154	Yes	Yes				Yes	No	Good		Yes		0.5	3.8	0
City	213	Yes	Yes				Yes	No	Good		Yes		1.3	3.5	0
City	214	Yes	Yes				Yes	Yes	Good		Yes		1.4	0.4	1
City	215	Yes	Yes				Yes	No	Good		Yes		1.8	3.0	0
City	216	Yes	Yes				Yes	Yes	Good		Yes		2.2	1.9	1
City	217	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.7	1
City	218	Yes	Yes				Yes	Yes	Fair		Yes		2.7	1.8	1
City	222	Yes	Yes				Yes	Yes	Good		Yes		3.2	1.6	1
City	223		Yes												0
City	224	Yes	Yes				Yes	No	Good		Yes		1.2	3.3	0
City	229	Yes	Yes				Yes	Yes	Good		Yes		3.5	1.1	1
City	230	Yes	Yes				No	No	Good		Yes		6.1	2.9	0
City	231	Yes	Yes				Yes	No	Good		Yes		0.8	2.1	0
City	237	Yes	Yes				Yes	Yes	Good		Yes		3.5	1.2	1
City	238	Yes	Yes				Yes	Yes	Good		Yes		3.5	0.1	1
City	239	Yes	Yes				Yes	Yes	Good		Yes		3.3	0.9	1
City	240	Yes	Yes				No	Yes	Good		Yes		7.7	1.3	0
City	241	Yes	Yes				Yes	No	Good		Yes		1.3	2.1	0
City	242	Yes	Yes				Yes	Yes	Good		Yes		1.2	1.0	1
City	243	Yes	Yes				Yes	Yes	Good		No		2.9	1.9	0
City	244	Yes	Yes				Yes	Yes	Good		Yes		1.7	0.5	1
City	245	Yes	Yes				No	Yes	Good		Yes		5.2	1.2	0
City	246	Yes	Yes				Yes	Yes	Good		Yes		0.9	0.8	1
City	247	Yes	Yes				Yes	Yes	Good		Yes		4.6	2.0	1
City	248	Yes	Yes				No	Yes	Good		Yes	Ponding	19.0	0.4	0
City	249	Yes	Yes				Yes	No	Fair		Yes	Ponding	0.5	2.3	0
City	250	Yes	Yes				No	Yes	Fair		Yes	Ponding	10.9	0.1	0
City	251	Yes	Yes				Yes	No	Good		Yes		0.9	3.2	0
City	252	Yes	Yes				Yes	Yes	Good		Yes		3.2	0.1	1
City	253	Yes	Yes		Yes	Yes	Yes	Yes	Fair		Yes		0.1	1.2	1
City	254	Yes	Yes					Yes	Good		Yes		0.9	1.2	1
City	257	Yes	Yes				Yes	No	Good		Yes		0.7	2.6	0
City	258	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.2	1
City	259	Yes	Yes				Yes	Yes	Good		Yes		0.5	1.4	1
City	260	Yes	Yes				Yes	No	Good		Yes		1.6	2.1	0
City	261	Yes	Yes				Yes	No	Good		Yes		1.5	3.0	0
City	262	Yes	Yes				No	Yes	Good		Yes		7.9	0.1	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	263	Yes	Yes				Yes	Yes	Good		Yes		10.1	0.6	1
City	264	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Fair		No		1.45	.95	0
City	265	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		No		1.1	2.15	0
City	266	Yes	Yes	N/A	N/A	N/A	Yes	No	Fair		No		1.2	5.5	0
City	302	Yes	Yes				Yes	No	Good		Yes		4.5	2.7	0
City	303	Yes	Yes				Yes	No	Good		No		1.1	2.7	0
City	304	Yes	Yes				Yes	No	Good		Yes		1.8	2.9	0
City	305	Yes	Yes				Yes	No	Good		Yes		0.4	6.9	0
City	306	Yes	Yes				Yes	No	Good		Yes		1.2	2.6	0
City	307	Yes	Yes				Yes	No	Good		Yes		0.8	3.3	0
City	321	Yes	Yes				Yes	No	Good		Yes		0.3	3.7	0
City	322	No	Yes				Yes	Yes	Fair		Yes		1.2	0.2	0
City	323	Yes	Yes				Yes	Yes	Good		Yes		2.0	0.9	1
City	324	Yes	Yes				Yes	No	Fair		Yes	Ponding	0.8	4.8	0
City	325	Yes	Yes				Yes	No	Fair		Yes		3.0	2.2	0
City	326	Yes	Yes				Yes	Yes	Good		Yes		2.0	1.0	1
City	327	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.4	1
City	328	Yes	Yes				Yes	Yes	Good		Yes		1.5	0.2	1
City	329	Yes	Yes				Yes	Yes	Good		Yes		0.6	1.7	1
City	330	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.3	1
City	331	Yes	Yes				Yes	Yes	Good		Yes		0.9	0.6	1
City	332	Yes	Yes				Yes	Yes	Good		No	Ponding	1.2	1.1	0
City	333	Yes	Yes				Yes	Yes	Fair	Some vegetation	Yes	Ponding	0.2	0.7	1
City	334	Yes	Yes				Yes	Yes	Good		Yes	Ponding	1.6	1.0	1
City	346	Yes	Yes				Yes	No	Good		Yes	Ponding	0.2	9.8	0
City	347	Yes	Yes				Yes	Yes	Good		Yes		0.5	0.6	1
City	348	Yes	Yes		Yes	Yes	No	Yes	Good	has railing	Yes		6.3	0.5	0
City	349	Yes	Yes				Yes	Yes	Good		Yes	Ponding	2.2	0.6	1
City	350	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Good		No		3.9	.3	0
City	351	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8	1	0
City	352	Yes	Yes	N/A	N/A	N/A	No	No	Good		No		9.5	3.1	0
City	460	Yes	Yes	N/A	Yes	Yes	No	Yes	Good	Some vegetation	Yes		6.9	1.3	0
City	461	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.0	1
City	462	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	2.0	1
City	463	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.4	0
City	464	Yes	Yes	N/A			Yes	No	Good	Some vegetation	Yes	Ponding	1.8	2.6	0
City	465	Yes	Yes	N/A			Yes	Yes	Fair	Some ponding and vertical crack	No	Ponding	0.8	0.5	0
City	466	Yes	Yes	N/A			Yes	Yes	Fair		No		1.4	0.1	0
City	467	Yes	Yes	N/A			Yes	No	Good		Yes	Ponding	1.9	2.4	0
City	468	No	Yes	N/A			No	Yes	Fair		No	Ponding	6.9	0.3	0
City	469	Yes	Yes	N/A			Yes	No	Good		Yes		0.3	2.7	0
City	470	Yes	Yes	N/A			Yes	No	Good		Yes		2.0	2.5	0
City	471	Yes	Yes	N/A			Yes	Yes	Fair	Some vegetation			2.2	0.4	1
City	676	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.5	1.0	1
City	677	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	1.7	1
City	678	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	3.5	0
City	679	Yes	Yes	N/A			Yes	No	Fair		No		2.6	2.6	0
City	680	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	1.0	1
City	681	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	0.7	1.7	1
City	682	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.4	1
City	683	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	4.4	0
City	701	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	2.4	0
City	702	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes		1.4	3.9	0
City	703	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.2	1
City	704	Yes	Yes	N/A			Yes	No	Good		Yes		0.95	2.75	0
City	1047	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	2.0	1
City	1048	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	2.8	0
City	1049	Yes	Yes	N/A			Yes	No	Good		Yes		2.6	2.6	0
City	1050	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	1.2	0.5	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1051	Yes	Yes	N/A			Yes	No	Good	driveway. might need curb ramps. vertical gap	No		1.6	7.2	0
City	1052	Yes	Yes	N/A			Yes	Yes	Fair	Some cracking	Yes		0.1	1.5	1
City	1053	Yes	Yes	N/A			No	No	Fair		Yes	Ponding	12.0	2.2	0
City	1054	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes		3.3	4.1	0
City	1055	Yes	Yes	N/A			No	Yes	Fair	Some vegetation	Yes		8.6	0.9	0
City	1056	Yes	Yes	N/A			Yes	No	Good		Yes		2.1	2.3	0
City	1057	Yes	Yes	N/A			Yes	No	Good		Yes		1.6	5.2	0
City	1058	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	2.6	0
City	1059	Yes	Yes	N/A			No	Yes	Good		Yes		0.0	1.6	0
City	1060	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	2.0	1
City	1061	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	2.9	0
City	1062	Yes	Yes	N/A			Yes	No	Good		Yes		1.1	2.8	0
City	1063	Yes	Yes	N/A			Yes	No	Good		Yes		3.9	2.4	0
City	1064	Yes	Yes	N/A			Yes	No	Good		Yes		3.7	5.4	0
City	1065	Yes	Yes	N/A			No	Yes	Good		Yes		5.7	1.5	0
City	1066	Yes	Yes	N/A			Yes	No	Good		Yes		3.8	2.8	0
City	1067	Yes	Yes	N/A			No	Yes	Good		Yes		5.6	1.1	0
City	1068	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.4	0.4	1
City	1069	Yes	Yes	N/A			No	No	Good		Yes		7.8	2.8	0
City	1070	Yes	Yes	N/A			Yes	No	Fair	Some cracking	Yes		4.8	2.9	0
City	1075	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.0	1
City	1076	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.2	0.0	1
City	1077									Under Construction					0
City	1078	Yes	Yes	N/A			Yes	No	Good		Yes		2.9	3.5	0
City	1079	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	0.5	1
City	1080									Under Construction					0
City	1081									Under Construction					0
City	1082	Yes	Yes	N/A			No	No	Good		Yes		7.1	2.8	0
City	1083	Yes	Yes	N/A			Yes	No	Good		Yes		1.6	2.9	0
City	1084	Yes	Yes	N/A			Yes	No	Good		Yes		1.7	4.5	0
City	1085	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.1	0.6	1
City	1086	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.5	0.1	1
City	1087	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.2	1
City	1088	Yes	No	N/A			Yes	No	Good		Yes		0.4	2.6	0
City	1089	Yes	No	N/A			Yes	No	Good		Yes		1.4	2.9	0
City	1090	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.6	0
City	1091	Yes	Yes	N/A			Yes	No	Fair	Some cracking	Yes		1.2	4.8	0
City	1092	Yes	Yes	N/A			Yes	Yes	Fair	Some cracking	Yes		1.2	1.7	1
City	1093	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.2	1.5	1
City	1094	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	1.5	1
City	1095	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.9	1.4	1
City	1096	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	2.0	1
City	1097	Yes	Yes	N/A				Yes	Good		Yes		1.6	1.7	1
City	1098	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	3.4	0
City	1216	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.4	0.8	1
City	1217	Yes	Yes	N/A	Yes		Yes	Yes	Good		Yes		0.4	0.3	1
City	1218	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	5.0	0
City	1219	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	0.7	1
City	1220	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	3.1	0
City	1221	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.5	1.9	1
City	1222	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.3	0
City	1223	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	0.5	1
City	1224	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.1	2.0	1
City	1225	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	1.3	1.3	1
City	1226	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	1.0	1
City	1227	Yes	Yes	N/A			Yes	No	Good		Yes		1.7	2.4	0
City	1228	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.5	1
City	1229	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	2.3	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1230	Yes	Yes	N/A			No	No	Good		Yes		6.1	3.2	0
City	1231	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.5	1
City	1232	Yes	Yes	N/A			Yes	No	Good		Yes		1.3	5.5	0
City	1233	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	1.6	1
City	1234	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	2.6	0
City	1235	Yes	Yes	N/A			No	No	Good		Yes		7.4	2.1	0
City	1236	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	1.5	1
City	1237	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	1.2	1
City	1238	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.7	0
City	1239	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	2.3	0
City	1240	Yes	Yes	N/A			No	Yes	Good		Yes		5.6	0.7	0
City	1241	Yes	Yes	N/A			Yes	Yes	Fair		Yes		2.0	1.9	1
City	1242	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	1.9	1
City	1243	Yes	Yes	N/A			No	No	Good		Yes		7.4	3.4	0
City	1244	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	1.8	1
City	1245	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.1	1.4	1
City	1246	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	5.2	0
City	1247	Yes	Yes	N/A			No	Yes	Good		Yes		5.5	1.6	0
City	1248	Yes	Yes	N/A			Yes	Yes	Good		Yes		.85	1.1	1
City	1249	Yes	Yes	N/A			No	Yes	Good		Yes		10.2	2	0
City	1250	Yes	Yes	N/A			No	No	Good		Yes		15.2	2.95	0
City	1251	Yes	Yes	N/A			No	No	Good		Yes		9.35	2.6	0
City	1324	Yes	Yes	N/A			Yes	No	Good		Yes		3.6	4.2	0
City	1325	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.2	1
City	1326	Yes	Yes	N/A			No	Yes	Good		Yes		6.1	0.9	0
City	1327	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	3.3	0
City	1328	Yes	Yes	N/A			Yes	Yes	Fair		No		1.2	0.1	0
City	1329	Yes	Yes	N/A			Yes	No	Good		Yes		2.2	2.8	0
City	1340	Yes	Yes	N/A			No	Yes	Good		Yes		10.7	1.5	0
City	1341	Yes	Yes	N/A			No	Yes	Good		Yes		7.6	0.6	0
City	1342	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	1.4	1
City	1343	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	1.2	1
City	1344	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	0.9	1
City	1345	Yes	Yes	N/A			Yes	Yes	Fair	Some cracking	No		4.6	0.0	0
City	1346	Yes	Yes	N/A			Yes	No	Good		Yes		0.0	5.6	0
City	1347	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	3.6	0
City	1348	Yes	Yes	N/A			No	No	Good		Yes		7.4	2.1	0
City	1354	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.2	2.0	1
City	1355	Yes	Yes	N/A			Yes	No	Fair		Yes		2.8	2.3	0
City	1356	Yes	Yes	N/A			No	No	Good		Yes		10.6	4.2	0
City	1357	Yes	Yes	N/A			No	Yes	Good		Yes		10.7	0.8	0
City	1358	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.6	0
City	1359	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	0.0	1
City	1360	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	3.1	0
City	1361	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	0.2	1
City	1362	Yes	Yes	N/A			Yes	No	Good		Yes		1.5	2.3	0
City	1363	Yes	Yes	N/A			No	Yes	Good		Yes		6.0	1.6	0
City	1364	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.9	0.1	1
City	1365	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.2	1
City	1366	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	0.1	1
City	1367	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	2.0	1
City	1368	Yes	Yes	N/A			Yes	No	Good		Yes		3.4	2.2	0
City	1369	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.9	1
City	1370	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	1.2	1
City	1371	Yes	Yes	N/A			No	Yes	Good		Yes		9.4	0.7	0
City	1372	Yes	Yes	N/A			No	Yes	Good		Yes		6.3	1.7	0
City	1373	Yes	Yes	N/A			No	Yes	Good		Yes		9.0	0.7	0
City	1374	Yes	Yes	N/A			Yes	No	Poor	Ponding	Yes	Both	4.0	2.2	0
City	1375	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	0.8	1
City	1376	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.4	0.5	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1377	Yes	Yes	N/A			Yes	No	Good		Yes		4.4	3.6	0
City	1378	Yes	Yes	N/A			Yes	No	Good		Yes		1.7	2.6	0
City	1379	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.9	1
City	1380	Yes	Yes	N/A			No	No	Poor	Ponding	Yes	Both	5.7	3.8	0
City	1381	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.5	1.0	1
City	1382	Yes	Yes	N/A	No		Yes	No	Good		Yes		1.2	3.8	0
City	1383	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.2	1
City	1384	Yes	Yes	N/A			No	No	Good		Yes		5.2	3.9	0
City	1385	Yes	Yes	N/A			Yes	Yes	Poor	Ponding	Yes	Both	0.8	1.8	0
City	1386	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	0.1	1
City	1387	Yes	Yes	N/A			No	Yes	Poor	Ponding	Yes	Both	5.9	1.1	0
City	1388	Yes	Yes	N/A			Yes	No	Good		Yes		1.0	3.5	0
City	1389	Yes	Yes	N/A			Yes	No	Good		Yes		1.7	2.9	0
City	1390	Yes	Yes	N/A			Yes	No	Good	Ponding	Yes	Both	0.4	3.7	0
City	1391	Yes	Yes	N/A			Yes	No	Good		Yes		.6	3.75	0
City	1392	Yes	No	N/A			Yes	No	Good		Yes		3.05	2.75	0
City	1393	Yes	No	N/A			Yes	Yes	Fair		No		.25	.25	0
City	1423	Yes	Yes	N/A			No	Yes	Good		Yes		7.9	0.4	0
City	1424	Yes	Yes	N/A			No	Yes	Good		Yes		5.3	0.0	0
City	1425	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	3.3	0
City	1426	Yes	Yes	N/A			Yes	No	Good		Yes		2.8	2.5	0
City	1427	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	1.1	1
City	1428	Yes	Yes	N/A			No	Yes	Good		Yes		5.8	1.8	0
City	1431	Yes	Yes	N/A			Yes	No	Good		Yes		1.6	3.8	0
City	1432	Yes	Yes	N/A			Yes	No	Good		Yes		4.0	6.3	0
City	1433	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	0.3	1
City	1434	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	9.4	0
City	1435	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.1	1.5	1
City	1436	Yes	Yes	N/A			No	No	Good		Yes		7.5	2.2	0
City	1437	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	1.8	1
City	1438	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.0	1.5	1
City	1439	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.2	1.6	1
City	1440	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	2.5	0
City	1441	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	0.9	1
City	1442	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.8	1
City	1443	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	0.9	1
City	1444	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.6	0.8	1
City	1445	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.6	1
City	1446	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	4.4	0
City	1447	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	0.6	1
City	1448									not paved					0
City	1452	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	1.1	1
City	1458	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	1.4	1
City	1459	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	1.0	1
City	1460	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.9	1
City	1461	Yes	Yes	N/A			No	No	Good		Yes		5.5	3.9	0
City	1462	Yes	Yes	N/A			Yes	No	Good		Yes		2.7	2.6	0
City	1463	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	0.8	1
City	1464	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.7	1
City	1465	Yes	Yes	N/A	Yes	Yes	No	Yes	Good		Yes		6.2	1.2	0
City	1466	Yes	Yes	N/A			No	Yes	Good		Yes		11.3	0.3	0
City	1470	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	1.6	1
City	1471	Yes	Yes	N/A			Yes	No	Good		Yes		2.9	3.3	0
City	1495	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	0.8	1
City	1496	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.4	1
City	1497	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.1	1
City	1498	Yes	Yes	N/A			Yes	No	Good		Yes		1.9	8.3	0
City	1499	Yes	Yes	N/A			Yes	No	Good		Yes		2.8	7.1	0
City	1500	Yes	Yes	N/A			Yes	No	Good		Yes		0.1	4.4	0
City	1501	Yes	Yes	N/A			Yes	No	Good		Yes		0.0	2.6	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1502	Yes	Yes	N/A			No	Yes	Good		Yes		7.4	0.6	0
City	1503	Yes	Yes	N/A			No	Yes	Good		Yes		6.5	0.7	0
City	1504	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	2.0	1
City	1505	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	0.2	1
City	1506	Yes	Yes	N/A			No	Yes	Good		Yes		9.7	1.3	0
City	1507	Yes	Yes	N/A			No	No	Good		Yes		19.0	2.7	0
City	1509	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.2	1
City	1510	Yes	Yes	N/A			Yes	Yes	Good		Yes		5.0	1.6	1
City	1511	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	0.7	1
City	1512	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.8	1.2	1
City	1513	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.1	0.4	1
City	1514	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	0.6	1
City	1515	Yes	Yes	N/A			Yes	No	Good		Yes		2.5	2.3	0
City	1516	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.2	0.5	1
City	1517	Yes	Yes	N/A			No	Yes	Good		Yes		6.4	1.8	0
City	1518	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	1.4	1
City	1519	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	0.2	1
City	1520	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	2.3	0
City	1521	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.8	0.6	1
City	1522	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.3	0.6	1
City	1523	Yes	Yes	N/A			No	Yes	Good		Yes		7.3	0.9	0
City	1524	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.8	1.3	1
City	1525	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.6	0
City	1526	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.3	1.1	1
City	1527	Yes	Yes	N/A			Yes	Yes	Poor	road	Yes		0.1	0.2	0
City	1528	Yes	Yes	N/A			Yes	Yes	Fair	road	Yes		2.0	0.2	1
City	1529	Yes	Yes	N/A			Yes	No	Good		Yes		2.5	2.5	0
City	1530	Yes	Yes	N/A			No	No	Good		Yes		9.6	3.2	0
City	1531	Yes	Yes	N/A			Yes	No	Good		Yes		3.9	2.3	0
City	1532	Yes	Yes	N/A			No	Yes	Good		Yes		5.3	1.0	0
City	1533	Yes	Yes	N/A			Yes	No	Good		Yes		3.6	2.5	0
City	1534	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.1	0.2	1
City	1535	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.0	1.0	1
City	1536	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.2	1
City	1537	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.0	1
City	1538	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.2	1
City	1539	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	2.6	0
City	1540	Yes	Yes	N/A			Yes	Yes	Good		Yes		1/4	0.3	1
City	1541	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	0.9	1
City	1542	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.5	0.5	1
City	1543	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.2	1.6	1
City	1544	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.1	1.7	1
City	1545	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	1.2	1
City	1546	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	0.2	1
City	1547	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.3	0
City	1548	Yes	Yes	N/A			No	No	Good		Yes		6.0	2.6	0
City	1549	Yes	Yes	N/A			No	Yes	Good		Yes		9.8	1.8	0
City	1550	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.6	1.2	1
City	1551	Yes	Yes	N/A			No	Yes	Good		Yes		6.4	1.1	0
City	1552	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	0.9	1
City	1553	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.1	2.0	1
City	1554	Yes	Yes	N/A			No	Yes	Good		Yes		6.6	0.9	0
City	1555	Yes	Yes	N/A			No	Yes	Good		Yes		6.6	0.8	0
City	1556	Yes	Yes	N/A			No	Yes	Good		Yes		9.0	0.4	0
City	1557	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.4	0.2	1
City	1558	Yes	Yes	N/A			Yes	No	Good		Yes		3.7	3.6	0
City	1559	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.7	1.8	1
City	1560	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	0.3	1
City	1561	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.9	1.6	1
City	1562	Yes	Yes	N/A			Yes	No	Good		Yes		2.8	3.2	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1563	Yes	Yes	N/A			Yes	No	Good		Yes		0.4	4.1	0
City	1572	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	2.5	0
City	1573	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	3.3	0
City	1574	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	2.7	0
City	1575	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.4	1
City	1576	Yes	Yes	N/A			Yes	No	Good		Yes		1.1	2.7	0
City	1577	Yes	Yes	N/A			Yes	No	Good		Yes		1.1	3.4	0
City	1578	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	3.7	0
City	1579	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	3.6	0
City	1580	Yes	Yes	N/A			Yes	No	Good		Yes		0.4	3.4	0
City	1581	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes		1.2	3.0	0
City	1582	Yes	Yes	N/A			No	Yes	Good		Yes		5.2	0.6	0
City	1583	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	3.6	0
City	1584	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	2.0	1
City	1585	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	5.4	0
City	1586	Yes	Yes	N/A			Yes	No	Good		Yes		3.1	6.2	0
City	1596	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	3.0	0
City	1597	Yes	Yes	N/A			No	Yes	Good	lake flood	Yes		6.0	0.0	0
City	1598	Yes	Yes	N/A			Yes	Yes	Good	Ponding	Yes		0.8	0.1	1
City	1599	Yes	Yes	N/A		Yes	Yes	Yes	Good	Ponding	Yes	Obstruction	2.2	0.3	0
City	1600	Yes	Yes	N/A			Yes	No	Good		Yes		0.3	5.6	0
City	1601	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.1	1
City	1602	Yes	Yes	N/A			Yes	No	Good		Yes		0.9	4.1	0
City	1603	Yes	Yes	N/A			Yes	No	Good		Yes		0.4	6.3	0
City	1604	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.7	1
City	1605	Yes	Yes	N/A			No	Yes	Good		Yes		7.9	0.0	0
City	1606	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	4.6	1.5	1
City	1607	Yes	Yes	N/A			Yes	Yes	Poor	Ponding	Yes	Ponding	3.8	0.5	0
City	1608	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.5	1.7	1
City	1609	Yes	Yes	N/A			Yes	No	Good		Yes		2.0	2.3	0
City	1610	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.1	1.0	1
City	1611	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.0	0.4	1
City	1612	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	0.9	1
City	1613	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.1	1
City	1614	Yes	Yes	N/A			No	No	Good		Yes		7.6	3.5	0
City	1615	Yes	Yes	N/A			No	Yes	Good		Yes		9.6	1.6	0
City	1616	Yes	No	N/A						not paved					0
City	1617	No	Yes							not paved trail					0
City	1618	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	0.1	0.6	1
City	1619	Yes	Yes	N/A			No	Yes	Good		Yes		9.8	1.8	0
City	1620	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.3	1.5	1
City	1621	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.0	1.8	1
City	1622	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	3.5	0
City	1623	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	1.4	1
City	1624	Yes	Yes	N/A			No	Yes	Good		Yes		5.5	0.7	0
City	1625	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	0.4	1
City	1626	Yes	Yes	N/A			Yes	Yes	Poor	Ponding	Yes	Ponding	1.4	0.4	0
City	1627	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.1	1.6	1
City	1630	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.1	1.5	1
City	1631	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	2.7	0
City	1632	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	0.5	1
City	1633	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	1.8	1
City	1634	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes		0.3	2.3	0
City	1635	Yes	Yes	N/A			No	Yes	Good		Yes		10.1	1.0	0
City	1636									not paved					0
City	1640	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	1.7	1
City	1645	Yes	Yes	N/A			Yes	Yes	Poor	sidewalk closed, dirt	Yes		4.0	0.1	0
City	1646	Yes	Yes	N/A			No	Yes	Poor	sidewalk closed	No		6.5	1.5	0
City	1647	Yes	Yes	N/A			Yes	No	Good		Yes		2.3	4.0	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
City	1648	Yes	Yes	N/A			No	No	Good		Yes		6.9	2.9	0
City	1649	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	0.6	1
City	1650	Yes	Yes	N/A			Yes	No	Good		Yes		1.6	2.4	0
City	1651	Yes	Yes	N/A			Yes	No	Good		Yes		1.6	2.4	0
City	1652	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.4	0.0	1
City	1653	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	2.9	0
City	1654	Yes	Yes	N/A			No	Yes	Good		Yes		7.4	0.9	0
City	1655	Yes	Yes	N/A			No	Yes	Good		Yes		6.6	1.8	0
City	1656	Yes	Yes	N/A			No	Yes	Good		Yes		6.3	0.0	0
City	1657	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	1.0	1
City	1658	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.1	1
City	1659	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	0.3	1
City	1660	Yes	Yes	N/A			No	No	Good		Yes		9.2	4.8	0
City	1661									not paved					0
City	1662	Yes	Yes	N/A			No	Yes	Good		Yes		6.4	1.9	0
City	1663									under construction					0
City	1664	Yes	Yes	N/A			Yes	No	Good		Yes		3.2	2.8	0
City	1665	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes		5.0	2.4	0
City	1666	Yes	Yes	N/A			Yes	Yes	Fair	Some vegetation	Yes		1.1	1.1	1
City	1671	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.2	0.7	1
City	1672	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.8	1
City	1673	Yes	Yes	N/A			Yes	No	Good		Yes		0.4	2.6	0
City	1674	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.4	1
City	1675	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.7	0
City	1676	Yes	Yes	N/A						under construction					0
City	1677	Yes	Yes	N/A			Yes	No	Good	under construction	Yes	Obstruction	0.8	2.6	0
City	1678	Yes	Yes	N/A			Yes	No	Good	under construction	Yes	Obstruction	1.3	2.5	0
City	1679	Yes	Yes	N/A			Yes	No	Good		Yes		1.2	2.5	0
City	1680	Yes	Yes	N/A			Yes	No	Good		Yes		1.3	2.4	0
City	1681	Yes	Yes	N/A			Yes	No	Good		Yes		2.9	2.2	0
City	1682	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.5	0.1	1
City	1683	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.3	2.0	1
City	1684	Yes	Yes	N/A			Yes	No	Good		Yes		1.0	3.8	0
City	1685	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.8	0
City	1688	Yes	Yes	N/A			Yes	No	Good	under construction	Yes		3.2	3.1	0
City	1689	Yes	Yes	N/A			Yes	Yes	Good		Yes	Ponding	2.4	0.4	1
City	1690	Yes	Yes	N/A			No	No	Good		Yes		5.5	3.7	0
City	1691	Yes	Yes	N/A			Yes	No	Good		Yes		3.8	2.4	0
City	1692	Yes	Yes	N/A			Yes	No	Good		Yes		4.8	4.1	0
City	1693	Yes	Yes	N/A			Yes	No	Good		Yes		3.1	2.6	0
City	1694	Yes	Yes	N/A			No	Yes	Good		Yes		8.0	0.8	0
City	1695	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.8	1
City	1696	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.65	.95	1

CITY OWNED:	573
# Compliant:	254
% Compliant:	44%

319 To be Reconstructed

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	38	Yes	0.7	Yes	1.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
	39	Yes	6.4	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.3	Yes	1
	40	Yes	6.7	Yes	1.8	Yes	Yes	Yes	No	No			Good		1.5	No	0
	41	Yes	4.3	Yes	4.9	No	Yes	No	No	No			Fair		2.9	No	0
	52	Yes	4.0	Yes	5.3	No	Yes	No	No	No			Good		2.4	Yes	0
	53	Yes	2.3	Yes	3.2	No	Yes	No	No	No			Good	large hole in crosswalk	3.1	Yes	0
	89	Yes	4.0	Yes	1.6	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
	90	Yes	6.2	Yes	1.2	Yes	Yes	No	Yes	No			Good		2.4	Yes	0
	98	Yes	1.8	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	99	Yes	5.5	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding	1.4	Yes	0
	100	Yes	0.6	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
	101	Yes	6.5	Yes	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0
	102	Yes	4.7	Yes	0.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.2	Yes	0
	103	Yes	0.5	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.0	Yes	0
	104	Yes	3.8	Yes	5.6	No	Yes	No	No	No			Fair		3.9	No	0
	105	Yes	1.3	Yes	7.4	No	Yes	No	No	No	No				7.4	No	0
	106	Yes	1.4	Yes	1.0	Yes	Yes	Yes	Yes	No			Fair	Some ponding and vegetation	1.3	Yes	0
	107	Yes	6.6	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.4	Yes	1
	108	Yes	5.1	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	0.9	Yes	0
	116	Yes	4.6	Yes	1.8	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		3.4	Yes	0
	118	Yes	12.6	No	1.3	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		12.6	Yes	0
	125	Yes	1.1	Yes	0.4	Yes	Yes	Yes	Yes	No			Good		1.3	Yes	0
	128	Yes	7.8	Yes	3.0	No	Yes	Yes	Yes	No			Fair	Ponding	1.8	Yes	0
	129	Yes	8.0	Yes	2.3	No	Yes	No	Yes	No			Good	bumpy to get to ramp	5.0	No	0
	130	Yes	3.1	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	131	Yes	2.8	Yes	0.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.2	Yes	1
	132	Yes	6.4	Yes	2.6	No	Yes	No	No	Yes	Yes	Yes	Fair	Some vegetation	3.5	Yes	0
	133	Yes	6.6	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	232	Yes	8.1	Yes	2.7	No	Yes	No	Yes	Yes	Yes	Yes	Good		1.8	Yes	0
	233	Yes	5.6	Yes	3.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	No	0
	234	Yes	5.1	Yes	4.4	No	Yes	No	No	No			Good		3.4	Yes	0
	235	Yes	4.7	Yes	6.4	No	Yes	No	No	No			Good		2.4	Yes	0
	236	Yes	0.3	Yes	5.1	No	Yes	No	No	No			Good	Ponding and pothole	2.7	No	0
	237	Yes	5.6	Yes	0.1	Yes	Yes	No	Yes	No			Fair	Major crack down middle of ramp	5.1		0
	238	Yes	8.8	No	1.6	Yes	Yes	No	No	No			Good		5.4	Yes	0
	239	Yes	6.0	Yes	3.8	No	Yes	No	Yes	No			Good	Some vegetation	4.7		0
	240	Yes	3.2	Yes	2.7	No	Yes	No	Yes	No			Fair	Some ponding and vegetation	2.2	Yes	0
	241	Yes	7.1	Yes	3.7	No	Yes	No	No	No			Fair		5.1	Yes	0
	242	Yes	7.9	Yes	2.3	No	Yes	No	Yes	No			Fair	Some vegetation	3.2	Yes	0
	243	Yes	7.7	Yes	2.3	No	Yes	No	No	No			Fair	Some cracking	4.2	No	0
	244	Yes	10.3	No	0.3	Yes	Yes	No	No	No			Fair	Ponding	6.1	Yes	0
	245	Yes	7.9	Yes	2.4	No	Yes	No	No	Yes	Yes	Yes	Good	No landing	na	Yes	0
	246	Yes	4.4	Yes	0.0	Yes	Yes	No	No	Yes	Yes	Yes	Good	Under construction	4.0	Yes	0
	247	Yes	4.7	Yes	1.1	Yes	Yes	No	No	Yes	Yes	Yes	Good	Under construction	4.4	Yes	0
	260	Yes	1.0	Yes	0.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	266	Yes	2.8	Yes	0.5	No	Yes	No	No	Yes	Yes	Yes	Good		6.2	Yes	0
	267	Yes	3.3	Yes	1.2	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.5	Yes	0
	268	Yes	2.3	Yes	1.8	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.2	Yes	0
	269	Yes	1.0	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	270	Yes	0.1	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	2.1		0
	271	Yes	4.4	Yes	0.2	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	2.1	Yes	0
	276	Yes	5.3	Yes	1.1	Yes	Yes	N/A	Yes	No			Fair		na	No	0
	277	Yes	3.6	Yes	0.3	Yes	Yes	Yes	No	No			Good		1.9	Yes	0
	288	Yes	2.6	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.0	Yes	1
	289	Yes	4.3	Yes	0.9	Yes	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	4.6	Yes	0
	290	Yes	3.6	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.1	Yes	0
	350	Yes	6.1	Yes	7.1	No	Yes	No	No	Yes	Yes	Yes	Good		3.4	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	351	Yes	1.3	Yes	2.2	No	Yes	No	No	Yes	Yes	Yes	Good	Ponding and under construction	3.9	Yes	0
	352	Yes	0.2	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	1.7	Yes	0
	353	Yes	1.8	Yes	2.6	No	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	2.0	Yes	0
	354	Yes	0.6	Yes	3.2	No	Yes	No	No	Yes	Yes	Yes	Good		3.8	Yes	0
	355	Yes	2.3	Yes	1.7	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		2.4	Yes	0
	356	Yes	3.5	Yes	2.6	No	Yes	No	Yes	No			Good		4.5	Yes	0
	357	Yes	10.0	No	1.4	Yes	Yes	No	Yes	Yes	Yes	Yes	Fair	Some vegetation	2.8	Yes	0
	358	Yes	3.7	Yes	6.3	No	Yes	No	No	Yes	Yes	Yes	Fair		4.5	No	0
	359	Yes	8.5	No	2.4	No	Yes	No	Yes	Yes	Yes	Yes	Fair		5.8	No	0
	360	Yes	3.0	Yes	3.5	No	Yes	Yes	Yes	No			Good	No flares needed	2.0	Yes	0
	361	Yes	2.6	Yes	0.9	Yes	Yes	No	Yes	No			Good	No flares needed	2.5	Yes	0
	362	Yes	5.5	Yes	1.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	0.9	Yes	0
	363	Yes	4.4	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good	Ponding and under construction	0.8	Yes	0
	364	Yes	3.7	Yes	0.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		4.5	Yes	0
	365	Yes	6.4	Yes	0.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		4.7	Yes	0
	366	Yes	4.4	Yes	1.7	Yes	Yes	No	No	Yes	Yes	Yes	Fair		4.8	Yes	0
	367	Yes	6.6	Yes	3.3	No	Yes	Yes	No	Yes	Yes	Yes	Fair		2.0	Yes	0
	368	Yes	7.4	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.2	Yes	1
	369	Yes	5.3	Yes	4.6	No	Yes	No	No	Yes	Yes	Yes	Fair	Ponding	2.8	Yes	0
	370	Yes	3.0	Yes	4.6	No	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Some vegetation	1.6	Yes	0
	371	Yes	2.9	Yes	2.3	No	Yes	No	Yes	Yes	Yes	Yes	Fair		2.2	Yes	0
	372	Yes	5.2	Yes	4.9	No	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	0
	373	Yes	0.2	Yes	1.7	Yes	Yes	Yes	No	No			Fair	Ponding	na	Yes	0
	374	Yes	9.9	No	0.8	Yes	Yes	Yes	No	No			Good		0.9	Yes	0
	380	Yes	1.1	Yes	1.2	Yes	Yes	N/A	No	No	Yes	Yes	Good		1.2	Yes	0
	381	Yes	1.5	Yes	1.2	Yes	Yes	N/A	No	Yes	Yes	Yes	Good		1.2	Yes	1
	382	Yes	2.9	Yes	2.1	No	Yes	Yes	No	Yes	Yes	Yes	Fair	Potholes	1.2	Yes	0
	383	Yes	2.5	Yes	2.4	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	384	Yes	0.3	Yes	0.9	Yes	Yes	N/A	No	No			Poor		0.9	Yes	0
	385	Yes	2.1	Yes	0.1	Yes	Yes	Yes	No	No			Good		1	Yes	0
	386	Yes	0.7	Yes	0.8	Yes	Yes	N/A	No	Yes	Yes	Yes	Good		0.8	Yes	1
	387	Yes	4.7	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	1
	388	Yes	4.3	Yes	0.0	Yes	Yes	No	No	No			Fair		2.5	Yes	0
	389	Yes	2.8	Yes	2.1	No	Yes	No	No	No			Fair		3.7	Yes	0
	390	Yes	1.0	Yes	4.0	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.3	Yes	0
	391	Yes	1.8	Yes	0.2	Yes	Yes	N/A	Yes	No			Good	Ponding	1.8	Yes	0
	392	Yes	4.3	Yes	0.0	Yes	Yes	No	Yes	No			Good	Ponding	2.4	Yes	0
	393	Yes	6.0	Yes	1.2	Yes	Yes	Yes	No	No			Good		1.0	Yes	0
	394	Yes	4.4	Yes	2.1	No	Yes	Yes	No	No			Good		1.5	Yes	0
	395	Yes	3.8	Yes	1.7	Yes	Yes	Yes	No	No			Good		0.5	Yes	0
	396	Yes	1.8	Yes	0.3	Yes	Yes	N/A	No	No			Good		1.8	Yes	0
	397	Yes	5.1	Yes	5.6	No	Yes	Yes	No	No			Poor	Some vegetation	1.7	No	0
	398	Yes	2.4	Yes	0.1	Yes	Yes	Yes	No	No			Fair	Some vegetation	0.4	Yes	0
	399	Yes	5.8	Yes	0.2	Yes	Yes	Yes	No	No			Fair	Some ponding and vegetation	0.9	Yes	0
	563	Yes	4.5	Yes	2.3	No	Yes	No	No	Yes	Yes	Yes	Good		11.8	No	0
	564	Yes	0.3	Yes	1.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	vertical	0.2	No	0
	565	Yes	2.4	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	566	Yes	6.4	Yes	3.1	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Ponding	2.2	Yes	0
	567	Yes	0.1	Yes	4.8	No	Yes	No	No	Yes	Yes	Yes	Good		2.5	Yes	0
	580	Yes	0.2	Yes	3.5	No	Yes	Yes	No	No			Fair	Ponding	0.9	Yes	0
	581	Yes	1.1	Yes	4.3	No	Yes	Yes	No	No			Fair	Ponding	1.6	Yes	0
	582	Yes	4.0	Yes	0.6	Yes		No	Yes	Yes	Yes	Yes	Poor	Some vegetation	2.5	No	0
	583	Yes	4.5	Yes	2.8	No	Yes	No	Yes	Yes	Yes	Yes	Good		2.3	Yes	0
	584	Yes	1.6	Yes	0.4	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Ponding	4.3	Yes	0
	585	Yes	2.2	Yes	0.4	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.6	No	0
	586	Yes	1.4	Yes	1.9	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		3.1	Yes	0
	587	Yes	1.2	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.6	No	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	841	Yes	0.7	Yes	4.3	No	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
	842	Yes	0.6	Yes	2.6	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	843	Yes	1.5	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
	844	Yes	6.0	Yes	2.3	No	Yes	No	Yes	Yes	Yes	Yes	Good		3.2	Yes	0
	845	Yes	5.3	Yes	2.3	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	846	Yes	0.2	Yes	0.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.6	Yes	1
	847	Yes	4.9	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	1
	848	Yes	5.2	Yes	2.7	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.2	Yes	0
	849	Yes	1.5	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	850	Yes	4.4	Yes	6.4	No	Yes	No	No	No	No	Yes	Good		5.5	Yes	0
	851	Yes	13.8	No	1.8	Yes	Yes	No	No	No	No	Yes	Good		8.3	Yes	0
	852	Yes	10.0	No	5.4	No	Yes	Yes	No	No	No	Yes	Good		1.8	Yes	0
	853	Yes	11.7	No	0.4	Yes	Yes	No	No	Yes	Yes	Yes	Good		5.0	Yes	0
	854	Yes	12.2	No	3.6	No	Yes	No	No	No			Poor	Gaps	7.3		0
	855	Yes	2.0	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
	856	Yes	4.1	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.8	Yes	1
	857	Yes	0.8	Yes	1.0	Yes	Yes	Yes			Yes	Yes	Good		1.0		1
	858	Yes	6.8	Yes	0.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	1
	859	Yes	0.3	Yes	2.5	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	0
	860	Yes	7.0	Yes	0.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.7	Yes	1
	861	Yes	4.5	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.2	Yes	1
	862	Yes	2.4	Yes	3.4	No	No	No	No	Yes	Yes	Yes	Good		4.8	Yes	0
	863	Yes	3.2	Yes	3.1	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
	864	Yes	8.7	No	1.5	Yes	Yes	No	No	Yes	Yes	Yes	Good		7.7	Yes	0
	865	Yes	1.4	Yes	3.8	No	Yes	No	No	Yes	Yes	Yes	Good		4.2	Yes	0
	866	Yes	2.2	Yes	1.7	Yes	Yes	No	Yes	No	Yes	No	Good		2.7	Yes	0
	867	Yes	2.4	Yes	0.6	Yes	Yes	Yes	Yes	No	Yes	No	Good		2.0	Yes	0
	868	Yes	6.7	Yes	0.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	869	Yes	1.9	Yes	1.6	Yes	Yes	Yes	No	No			Good		1.9	Yes	0
	870	Yes	0.0	Yes	2.4	No	Yes	Yes	No	No			Good		1.5	Yes	0
	884	Yes	1.3	Yes	1.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation	1.7	Yes	0
	885	Yes	6.2	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation	2	Yes	0
	886	Yes	3.8	Yes	0	Yes	Yes	Yes		No			Good	No flares needed	2.0	Yes	0
	887	Yes	1.9	Yes	1.8	Yes	Yes	Yes		No			Good	No flares needed	1.8	Yes	0
	888	Yes	0.5	Yes	0.2		Yes	Yes		No			Fair	No flares needed and ponding	0.5		0
	889	Yes	2.2	Yes	2.4	No	Yes	No		No			Good	No flares needed	4.2	Yes	0
	890	Yes	4.8	Yes	2.1	No	Yes	No		No			Fair	No flares needed and ponding	2.2	Yes	0
	891	Yes	1.2	Yes	2.4	No	Yes	No		No			Good	No flares needed	3.0	Yes	0
	892	Yes	0.8	Yes	2.9	No	Yes	No		No			Good	No flares needed	4.7	Yes	0
	893	Yes	0.2	Yes	5.6	No	Yes	No		No			Good	No flares needed	5.7	Yes	0
	894	Yes	0.9	Yes	1.1	Yes	Yes	Yes		No			Good	No flares needed	1.1	Yes	0
	895	Yes	5.3	Yes	1.6	Yes	Yes	Yes	Yes	No			Good		0.6	Yes	0
	896	Yes	1.5	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
	897	Yes	4.1	Yes	1.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.8	Yes	1
	898	Yes	1.7	Yes	1.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	1
	899	Yes	2.5	Yes	2.3	No	Yes	No	Yes	Yes	Yes	Yes	Good		2.5	Yes	0
	900	Yes	1.4	Yes	0.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	1
	901	Yes	2.3	Yes	1.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	1
	902	Yes	1.7	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	903	Yes	3.5	Yes	2.4	No	Yes	No	Yes	Yes	Yes	Yes	Good		3.7	Yes	0
	904	Yes	1.6	Yes	0.8	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	1
	905	Yes	1.5	Yes	1.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.7	Yes	1
	912	Yes	1.8	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	2.0	Yes	1
	913	Yes	1.1	Yes	1.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.5	Yes	1
	914	Yes	0.3	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.1	Yes	1
	915	Yes	3.3	Yes	2.6	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	0
	916	Yes	1.4	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.4	Yes	1
	917	Yes	2.1	Yes	1.3	Yes	Yes	No		Yes	Yes	Yes	Fair	Ponding	3.6	Yes	0
	918	Yes	3.5	Yes	0.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.3	Yes	1

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	919	Yes	3.6	Yes	0.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	0.5	Yes	1
	920	Yes	4.6	Yes	2.8	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.3	Yes	0
	921	Yes	6.2	Yes	2.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.1	Yes	0
	922	Yes	3.2	Yes	4.6	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	923	Yes	3.2	Yes	5.2	No	Yes	Yes	No	No			Good		1.4	Yes	0
	934	Yes	7.4	Yes	0.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	935	Yes	2.3	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.0	Yes	1
	936	Yes	5.7	Yes	1.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.7	Yes	1
	937		0	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.1	Yes	1
	1439	Yes	1.3	Yes	2.0	Yes	Yes	Yes	Yes	No			Good		2.0	Yes	0
	1440	Yes	1.2	Yes	1.5	Yes	Yes	Yes	Yes	No			Good		1.5	Yes	0
	1441	Yes	1.2	Yes	1.5	Yes	Yes	Yes	Yes	No	Yes		Good		1.5	Yes	0
	1442	Yes	1.0	Yes	1.6	Yes	Yes	Yes	Yes	No			Good		1.6	Yes	0
	1443	Yes	1.8	Yes	0.8	Yes	Yes	Yes	No	No			Good		1.8	Yes	0
	1444	Yes	2.3	Yes	4.2	No	Yes	No	No	No			Good		2.9	Yes	0
	1445	Yes	1.7	Yes	6.4	No	Yes	No	Yes	No		Yes	Good		3.6	Yes	0
	1446	Yes	2.9	Yes	6.5	No	Yes	No	Yes	No			Good		4.7	Yes	0
	1447	Yes	2.9	Yes	0.7	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.3	Yes	0
	1448	Yes	4.0	Yes	1.3	Yes	Yes	No	No	Yes	Yes	Yes	Good		3.7	Yes	0
	1449	Yes	0.1	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
	1450	Yes	0.5	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
	1451	Yes	5.0	Yes	0.5	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
	1452	Yes	5.4	Yes	1.0	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
	1453	Yes	2.0	Yes	0.5	Yes	Yes	Yes	No	No			Good		2.0	Yes	0
	1454	Yes	2.4	Yes	1.8	Yes	Yes	Yes	No	No			Good		1.8	Yes	0
	1455	Yes	3.9	Yes	0.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	1
	1457	Yes	5.5	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	1458	Yes	1.5	Yes	1.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.5	Yes	1
	1459	Yes	4.6	Yes	0.0	Yes	Yes	No	Yes	No			Good		4.0	Yes	0
	1460	Yes	8.4	No	1.5	Yes	Yes	No	Yes	No		Yes	Good		2.3	Yes	0
	1461	Yes	0.9	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.3	Yes	1
	1462	Yes	6.2	Yes	0.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.5	Yes	1
	1463	Yes	1.8	Yes	1.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.5	Yes	1
	1464	Yes	0.1	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.2	Yes	1
	1465	Yes	7.5	Yes	1.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
	1466	Yes	6.9	Yes	1.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.3	Yes	1
	1467	Yes	0.9	Yes	0.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.9	Yes	1
	1468	Yes	0.6	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	1
	1469	Yes	3.5	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	1
	1470	Yes	6.5	Yes	1.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	1
	1471	Yes	1.2	Yes	1.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1472	Yes	1.3	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.3	Yes	0
	1473	Yes	0.7	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.4	Yes	1
	1474	Yes	0.4	Yes	0.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	1
	1475	Yes	0.1	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.8	Yes	0
	1476	Yes	1.4	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	1477	Yes	0.7	Yes	0.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
	1478	Yes	0.2	Yes	1.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
	1479	Yes	4.1	Yes	1.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.7	Yes	1
	1480	Yes	1.0	Yes	0.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.0	Yes	1
	1481	Yes	0.5	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.5	Yes	1
	1482	Yes	1.7	Yes	0.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.7	Yes	1
	1483	Yes	6.6	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good	Ponding	1.2	Yes	1
	1484	Yes	6.1	Yes	0.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	0.9	Yes	1
	1485	Yes	7.0	Yes	1.7	Yes	Yes	No	Yes	Yes	Yes	Yes	Good		5.2	Yes	0
	1578	Yes	7.2	Yes	1.0	Yes	Yes	Yes	No	No			Good		0.8	Yes	0
	1579	Yes	9.7	No	0.0	Yes	Yes	No	No	No			Fair	Cracking and ponding	5.0	No	0
	1581	Yes	4.3	Yes	2.5	No	Yes	No	Yes	No			Good		5.0	Yes	0
	1582	Yes	7.2	Yes	11.5	No	Yes	No	No	No			Good		6.3	Yes	0
	1585	Yes	7.2	Yes	1.4	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.6	Yes	1
	1586	Yes	6.5	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.0	Yes	1
	1587	Yes	1.0	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
	1588	Yes	4.5	Yes	2.6	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	1589	Yes	7.6	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1590	Yes	4.5	Yes	2.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
	1591	Yes	6.0	Yes	1.8	Yes	Yes	Yes	Yes	No			Good		1.1	Yes	0
	1592	Yes	1.4	Yes	1.0	Yes	Yes	Yes	Yes	No			Good		1.4	Yes	0
	1593	Yes	0.9	Yes	2.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	1594	Yes	0.8	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
	1595	Yes	0.5	Yes	1.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.2	Yes	1
	1596	Yes	7.0	Yes	0.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.0	Yes	0
	1597	Yes	1.6	Yes	1.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	1598	Yes	6.6	Yes	0.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.9	Yes	1
	1599	Yes	4.1	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1600	Yes	3.3	Yes	2.6	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1601	Yes	8.9	No	5.4	No	Yes	No	Yes	Yes	Yes	Yes	Fair	Some vegetation	2.7	Yes	0
	1602	Yes	6.2	Yes	5.5	No	Yes	No	No	Yes	No	Yes	Good		3.1	Yes	0
	1603	Yes	7.3	Yes	5.8	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	0
	1604	Yes	4.9	Yes	7.0	No	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	0
	1605	Yes	6.6	Yes	4.4	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	1606	Yes	2.8	Yes	3.2	No	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	0
	1607	Yes	2.3	Yes	3.0	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	1608	Yes	1.1	Yes	3.8	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
	1609	Yes	2.1	Yes	2.6	No	Yes	No	No	Yes	Yes	Yes	Good		6.5	Yes	0
	1610		0.6	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.6	Yes	1
	1611	Yes	5.7	Yes	1.1	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	1
	1612	Yes	6.8	Yes	0.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.8	Yes	1
	1613	Yes	0.5	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.6	Yes	0
	1614	Yes	1.3	Yes	0.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.3	Yes	1
	1615	Yes	0.3	Yes	1.4	Yes	Yes	Yes	Yes	No			Good		1.4	Yes	0
	1616	Yes	5.8	Yes	1.0	Yes	Yes	Yes	Yes	No			Fair	horizontal gap	1.4	Yes	0
	1617	Yes	5.8	Yes	0.5	Yes	Yes	No	Yes	No			Good		5.5	Yes	0
	1618	Yes	4.5	Yes	1.9	Yes	Yes	No	Yes	No			Fair	Some ponding and vegetation	4.3	Yes	0
	1619	Yes	6.2	Yes	7.5	No	Yes	No	No	No			Fair	Some ponding and vegetation	4.1	Yes	0
	1620	Yes	5.0	Yes	2.4	No	Yes	No	No	No			Fair	Ponding	3.0	Yes	0
	1621	Yes	5.0	Yes	2.8	No	Yes	Yes	Yes	No			Fair	Some cracking and ponding	1.7	Yes	0
	1622	Yes	7.0	Yes	1.5	Yes	Yes	Yes	Yes	No			Fair	Some vegetation	1.5	Yes	0
	1623	Yes	1.6	Yes	8.2	No	Yes	No	Yes	No			Good		3.8	Yes	0
	1624	Yes	3.0	Yes	5.7	No	Yes	Yes	No	No			Fair	Ponding	1.8	Yes	0
	1625	Yes	5.2	Yes	1.0	Yes	Yes	Yes	Yes	No			Good		1.8	Yes	0
	1626	Yes	1.6	Yes	4.3	No	Yes	No	Yes	No			Fair	Ponding	3.3	Yes	0
	1627	Yes	3.6	Yes	1.3	Yes	Yes	No	No	No			Good		2.6	Yes	0
	1628	Yes	10.0	No	1.0	Yes	Yes	No	No	No			Good		10.0	Yes	0
	1646	Yes	0.6	Yes	4.9	No	Yes	No	Yes	No	Yes	Yes	Fair	Ponding	4.9	Yes	0
	1647	Yes	4.2	Yes	1.3	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Ponding	3.5	Yes	0
	1648	Yes	6.3	Yes	4.8	No	Yes	Yes	No	No			Good		0.6	Yes	0
	1649	Yes	0.4	Yes	1.9	Yes	Yes	Yes	No	No			Good		1.9	Yes	0
	1769	Yes	6.9	Yes	10.7	No	Yes	No	No	No	No		Fair	Some cracking	6.4	Yes	0
	1770	Yes	0.1	Yes	4.3	No	Yes	No	No	Yes	Yes	Yes	Good		4.3	Yes	0
	1771	Yes	4.1	Yes	7.1	No	Yes	No	No	Yes	Yes	Yes	Good		7.1	Yes	0
	1772	Yes	3.6	Yes	3.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
	1773	Yes	15.2	No	1.7	Yes	Yes	No	No	No	No	Yes	Poor	Some cracking and vegetation	8.6	No	0
	1774	Yes	2.5	Yes	1.7	Yes	Yes	No	No	No			Fair		2.4	No	0
	1775	Yes	1.5	Yes	1.6	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	1
	1776	Yes	8.8	No	1.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
	1777	Yes	3.0	Yes	3.8	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.4	Yes	0
	1778	Yes	8.1	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.5	Yes	1
	1779	Yes	1.1	Yes	1.1	Yes	Yes	Yes	No	No			Good		1.1	Yes	0
	1780	Yes	1.8	Yes	1.5	Yes	Yes	Yes	No	No	No	No	Good		1.8	Yes	0
	1781	Yes	2.0	Yes	0.7	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	1782	Yes	5.2	Yes	0.6	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.6	Yes	0
	1783	Yes	1.6	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	1784	Yes	0.6	Yes	1.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
	1785	Yes	10.1	No	1.1	Yes	Yes	No	No	Yes	Yes	Yes	Good		4.5	Yes	0
	1786	Yes	0.5	Yes	0.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	0.8	Yes	0
	1787	Yes	16.4	No	0.9	Yes	Yes	No		No			Fair	gutter in curb ramp, no flares	12.3	No	0
	1788	Yes	4.5	Yes	2.7	No	Yes	Yes	No	No			Good		2.0	Yes	0
	1791	Yes	3.8	Yes	0.2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		0.9	Yes	1
	1792	Yes	0.2	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.8	Yes	0
	1793	Yes	2.0	Yes	0.5	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	1794	Yes	6.5	Yes	2.0	Yes	Yes	Yes	No	No			Good	No Flares needed	0.8	Yes	0
	1795	Yes	9.3	No	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.2	Yes	0
	1887	Yes	6.1	Yes	0.4	Yes	Yes	No	No	No			Fair	Some vegetation	3.7	Yes	0
	1888	Yes	6.7	Yes	3.5	No	Yes	No	No	No			Poor	Some ponding and vegetation	4.2	Yes	0
	1889	Yes	8.8	No	3.2	No	Yes	Yes	No	Yes	Yes	Yes	Fair	Electrical pole obstruction	1.3	Yes	0
	1890	Yes	7.4	Yes	0.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.9	Yes	0
	1891	Yes	10.0	No	2.8	No	Yes	No	No	No			Good		3.5	Yes	0
	1892	Yes	3.1	Yes	6.0	No	Yes	No	No	No			Good		2.9	Yes	0
	1905	Yes	5.8	Yes	1.9	Yes	Yes	No	No	Yes	Yes	Yes	Good		4.8	Yes	0
	1906	Yes	2.3	Yes	0.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
	1919	Yes	2.4	Yes	2.3	No	Yes	Yes	No	No			Good		1.5	Yes	0
	1920	Yes	2.3	Yes	2.3	No	Yes	Yes	No	No			Good		1.9	Yes	0
	1921	Yes	3.0	No	1.1	Yes	Yes	Yes	No	No			Fair		1.1	Yes	0
	1922	Yes	7.4	Yes	1.8	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.7	Yes	0
	1924	Yes	7.0	Yes	2.1	No	Yes	No	No	Yes	Yes	Yes	Good		2.2	Yes	0
	1925	Yes	6.7	Yes	5.4	No	Yes	No	No	Yes	Yes	Yes	Good		3.3	Yes	0
	1926	Yes	1.0	Yes	0.4	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair		1.0	No	0
	1927	Yes	6.2	Yes	1.7	Yes	Yes	No	No	No			Fair	Ponding	6.2	Yes	0
	1928	Yes	4.1	Yes	0.2	Yes	Yes	No	No	No			Poor	Ponding	4.6	No	0
	1929	Yes	6.4	Yes	2.8	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	0
	1930	Yes	5.3	Yes	3.7	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.1	Yes	0
	1931	Yes	1.0	Yes	2.6	No	Yes	No	No	Yes	Yes	Yes	Good		2.8	Yes	0
	1932	Yes	2.0	Yes	0.5	Yes	Yes	Yes	Yes	No			Fair	Pothole on side of ramp	2.0	Yes	0
	1933	Yes	3.2	Yes	0.6	Yes	Yes	Yes	Yes	No			Fair	Ponding	1.8	Yes	0
	1953	Yes	6.1	Yes	1.7	Yes	Yes	No	No	No			Fair	Ponding	7.4	Yes	0
	1954	Yes	1.3	Yes	4.6	No	Yes	No	No	No			Good		2.9	Yes	0
	1955	Yes	2.3	Yes	2.1	No	Yes	No	Yes	No			Poor	Some cracking	4.1	No	0
	1956	Yes	7.2	Yes	3.9	No	Yes	No	No	No			Fair	Ponding	2.6	Yes	0
	1957	Yes	8.6	No	2.4	No	Yes	No	No	No			Fair	Some vegetation	4.0	Yes	0
	1958	Yes	6.0	Yes	0.6	Yes	Yes	Yes	No	No			Good		0.9	Yes	0
	1959	Yes	4.0	Yes	0.4	Yes	Yes	No	No	No			Good		6.4	Yes	0
	1961	Yes	0.4	Yes	2.8	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.1	Yes	0
	1962	Yes	2.3	Yes	0.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	2.0	Yes	0
	1963	Yes	5.3	Yes	8.4	No	Yes	No	No	No			Good		10.8	Yes	0
	1964	Yes	6.0	Yes	1.2	Yes	Yes	No	No	No			Good		3.5	Yes	0
	1965	Yes	6.1	Yes	5.3	No	Yes	No	No	No			Good		2.5	Yes	0
	1966	Yes	4.2	Yes	3.8	No	Yes	No		No			Good	No flares	3.4	Yes	0
	1967	Yes	1.0	Yes	4.7	No	Yes	No		No			Good	No flares	3.7	Yes	0
	1968	Yes	12.8	No	4.3	No	Yes	No	No	No			Fair	Some cracking	5.2	No	0
	1969	Yes	9.2	No	3.0	No	Yes	No	No	No			Fair	Some cracking	3.9	No	0
	1970	Yes	12.3	No	5.2	No	No	No	No	No			Good		4.5	Yes	0
	1971	Yes	7.2	Yes	5.5	No	Yes	No	No	No			Good		3.1	Yes	0
	1972	Yes	1.3	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	1973	Yes	0.7	Yes	1.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.6	Yes	0
	1974	Yes	11.5	No	4.2	No	Yes	No	No	No			Good		5.4	Yes	0
	1975	Yes	4.5	Yes	7.9	No	Yes	No	No	No			Good		5.6	Yes	0
	1976	Yes	3.7	Yes	3.7	No	Yes	No		No		Yes	Good	No flares	4.4	Yes	0
	1977	Yes	0.6	Yes	6.2	No	Yes	No	No	No			Good		4.4	Yes	0
	1978	Yes	10.4	No	5.5	No	Yes	No	No	No			Good		5.3	Yes	0
	1979	Yes	9.7	No	6.8	No	Yes	No	No	No			Fair	Some vegetation	5.4	No	0
	1980	Yes	7.8	Yes	8.0	No	Yes	No	No	No			Fair	Some cracking	7.3	No	0
	1981	Yes	4.3	Yes	7.5	No	Yes	No	No	No			Fair		7.3	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	1982	Yes	10.8	No	9.2	No	Yes	No	No				Good		6.7	Yes	0
	1983	Yes	3.9	Yes	7.8	No	Yes	No	No	No			Good		4.1	Yes	0
	1984	Yes	1.5	Yes	1.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	1985	Yes	0.6	Yes	1.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1986	Yes	0.5	Yes	2.8	No	Yes	No	No	No			Fair	Ponding	3.4	Yes	0
	1987	Yes	3.5	Yes	2.2	No	Yes	No	No	No			Good		3.4	Yes	0
	1988	Yes	0.5	Yes	1.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	1989	Yes	0.1	Yes	0.9	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0
	1990	Yes	1.8	Yes	0.5	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.8	Yes	0
	1991	Yes	0.1	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.2	Yes	0
	1992	Yes	5.2	Yes	0.7	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	1993	Yes	0.8	Yes	0.6	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		0.8	Yes	0
	1994	Yes	1.3	Yes	0.1	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.3	Yes	0
	1995	Yes	0.9	Yes	2.7	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.5	Yes	0
	1996	Yes	5.8	Yes	2.9	No	Yes	No		No			Good	No flares	5.0	Yes	0
	1997	Yes	0.9	Yes	3.9	No	Yes	No		No			Good	No flares	3.0	Yes	0
	1998	Yes	6.6	Yes	6.0	No	Yes	No	No	No			Good		6.5	Yes	0
	1999	Yes	0.1	Yes	2.3	No	Yes	No	No	No			Good		2.3	Yes	0
	2000	Yes	0.7	Yes	2.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	1
	2001	Yes	7.3	Yes	3.1	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.1	Yes	0
	2002	Yes	8.2	Yes	0.3	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Fair	Some vegetation	1.7	Yes	1
	2003	Yes	2.0	Yes	0.9	Yes	Yes	Yes		Yes	Yes	Yes	Fair	Some vegetation	2.0	Yes	1
	2004	Yes	8.4	No	2.0	Yes	Yes	No	No	Yes	Yes	Yes	Good		6.2	Yes	0
	2005	Yes	1.1	Yes	2.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		2.0	Yes	0
	2017	Yes	0.9	Yes	0.5	Yes	Yes	Yes	No	No			Good		0.9	Yes	0
	2018	Yes	5.8	Yes	1.6	Yes	Yes	No	No	No			Fair	Ponding	4.8	Yes	0
	2027	Yes	4.4	Yes	1.1	Yes	Yes	No	No	Yes	Yes	Yes	Good		2.1	Yes	0
	2044	Yes	9.6	No	0.4	Yes	Yes	No	No	No			Fair	Ponding	2.7	Yes	0
	2045	Yes	5.0	Yes	5.3	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	0
	2046	Yes	8.7	No	2.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	0
	2047	Yes	5.0	Yes	0.2	Yes	Yes	No	Yes	No			Poor	signs say no walking, Some ponding and vegetation	3.6	Yes	0
	2048	Yes	8.3	Yes	5.7	No	Yes	No	No	No			Good		4.0	Yes	0
	2049	Yes	8.5	No	8.3	No	Yes	No	No	No			Good		4.1	Yes	0
	2050	Yes	6.7	Yes	9.1	No	Yes	Yes	No	No			Fair	Ponding, median with no curb ramps	1.4	Yes	0
	2051	Yes	3.2	Yes	0.2	Yes	Yes	No	No	No	Yes	Yes	Good	median with no curb ramps	3.2	Yes	0
	2052	Yes	7.0	Yes	3.4	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.6	Yes	0
	2053	Yes	5.1	Yes	1.3	Yes	Yes	No	No	No	Yes	Yes	Good		3.5	Yes	0
	2054	Yes	1.7	Yes	1.1	Yes	Yes	Yes		Yes	Yes	Yes	Good	No flares	1.7	Yes	1
	2055	Yes	1.8	Yes	0.2	Yes	Yes	Yes		Yes	Yes	Yes	Good	No flares	1.8	Yes	1
	2056	Yes	8.1	Yes	0.2	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Some vegetation	1.2	Yes	0
	2057	Yes	5.3	Yes	3.2	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.3	Yes	0
	2058	Yes	3.6	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.0	Yes	0
	2059	Yes	0.2	Yes	7.3	No	Yes	No	No	Yes	Yes	Yes	Good		3.5	Yes	0
	2060	Yes	3.8	Yes	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	2090	Yes	3.7	Yes	1.5	Yes	Yes	No		No			Good	No flares	3.0	Yes	0
	2091	Yes	1.7	Yes	2.4	No	Yes	No	No	No			Good		3.4	Yes	0
	2092	Yes	3.2	Yes	1.3	Yes	Yes	No	No	No			Good		2.4	Yes	0
	2093	Yes	0.7	Yes	2.9	No	Yes	No	No	No			Good		4.2	Yes	0
	2094	Yes	2.7	Yes	4.5	No	Yes	Yes	No	No			Good		1.5	Yes	0
	2095	Yes	7.6	Yes	4.2	No	Yes	No	No	No			Good		2.7	Yes	0
	2096	Yes	0.5	Yes	1.7	Yes	Yes	Yes	No	No			Good		1.7	Yes	0
	2097	Yes	13.3	No	0.2	Yes	Yes	Yes	No	No			Poor		1.7	No	0
	2098	Yes	10.2	No	0.5	Yes	Yes	Yes	No	No			Fair		2.0	No	0
	2099	Yes	5.4	Yes	1.0	Yes	Yes	Yes	No	Yes	Yes	Yes	Good		1.4	Yes	0
	2100	Yes	8.7	No	2.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.9	Yes	0
	2101	Yes	0.2	Yes	1.3	Yes	Yes	Yes		Yes	Yes	Yes	Good	No flares	1.3	Yes	1
	2102	Yes	0.6	Yes	0.2	Yes	Yes	Yes		Yes	Yes	Yes	Good	No flares	0.6	Yes	1
	2103	Yes	1.0	Yes	2.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		1.9	Yes	0
	2104	Yes	5.0	Yes	5.5	No	Yes	Yes	No	Yes	Yes	Yes	Good		0.4	Yes	0

Ownership	OBJECTID	If walk/trail crosses curb, is there a curb ramp?	What is the running slope of the curb ramp?	Running slope <= 8.3%?	What is the cross slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w\ adjacent surfaces?	Curb Ramp overall condition?	Notes	What is the max landing slope?	Are there no gaps in elevation or distance between concrete panels >1.5?	Compliant 1=Compliant
	2105	Yes	8.7	No	0.9	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		2.0	Yes	0
	2106	Yes	3.5	Yes	7.3	No	Yes	No	No	Yes	Yes	Yes	Good		3.5	Yes	0
	2107	Yes	5.4	Yes	3.1	No	Yes	No	Yes	Yes	Yes	Yes	Good		5.5	Yes	0
	2108	Yes	10.6	No	2.0	Yes	Yes	Yes	No	No	Yes	Yes	Fair	Some vegetation	1.5	Yes	0
	2109	Yes	2.6	Yes	3.3	No	Yes	No	Yes	No			Good		3.0	Yes	0
	2118	Yes	9.9	No	0.6	Yes	Yes	No	No	No			Fair	Ponding	9.9	Yes	0
	2119	Yes	9.9	No	0.6	Yes	Yes	No	No	No			Fair	Ponding	9.9	Yes	0
	2120	Yes	14.3	No	1.4	Yes	Yes	No	No	No			Fair	Some ponding and vegetation	3.8	Yes	0
	2121	Yes	1.1	Yes	0.3	Yes	Yes	Yes		No	Yes	Yes	Good	No flares	1.1	Yes	0
	2122	Yes	2.3	Yes	1.0	Yes	Yes	No	No	Yes	Yes	Yes	Fair	Some vegetation	2.3	Yes	0
	2123	Yes	1.6	Yes	1.3	Yes	Yes	Yes	No	Yes	Yes	Yes	Fair	Ponding	1.6	Yes	0
	2124	Yes	9.0	No	0.1	Yes	Yes	Yes	No	No			Good	No flares	2.0	Yes	0
	2125	Yes	6.6	Yes	0.0	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.8	Yes	1
	2126	Yes	5.9	Yes	2.6	No	Yes	No	Yes	No			Good		2.3	Yes	0
	2127													Under construction			0
	2128	Yes	5.2	Yes	0.4	Yes	Yes	Yes	No	No			Good		1.6	Yes	0
	2129	Yes	3.8	Yes	5.3	No	Yes	No	No	No			Fair	Ponding	3.5	Yes	0
	2154													Under construction			0
	2155	Yes	6.9	Yes	2.9	No	Yes	No	No	No			Poor	Ponding	6.9	No	0
	2156	Yes	7.2	Yes	10.4	No	Yes	Yes	No	No			Fair	Some ponding and vegetation	2.0	Yes	0
	2157	Yes	0.4	Yes	2.5	No	Yes	No	Yes	No	Yes	Yes	Fair	to get up to sidewalk it is 25.7	2.2	Yes	0
	2158	Yes	4.9	Yes	2.4	No	Yes	No	Yes	Yes	Yes	Yes	Fair	to get to sidewalk it is 24.7	4.5	Yes	0
	2159	Yes	0.5	Yes	3.9	No	Yes	Yes	Yes	Yes	Yes	Yes	Good		1.9	Yes	0
	2160	Yes	9.8	No	5.5	No	Yes	No	No	Yes	Yes	Yes	Good	Under construction	5.0	Yes	0
	2190	Yes	8.2	Yes	5.8	No	Yes	No	Yes	No			Good		5.1	Yes	0
	2207	Yes	2.5	Yes	3.0	No	Yes	Yes	No	No			Good	No flares	0.9	Yes	0
	2208	Yes	10.3	No	4.8	No	Yes	No	Yes	No			Fair	Ponding	2.3	Yes	0
	2209	Yes	10.8	No	4.7	No	Yes	No	Yes	No			Fair		2.3	Yes	0
	2210													Under construction			0
	2211													Under construction			0

County/State:	444		
# Compliant:	77	367	To be Reconstructed
% Compliant:	17%		
CITY-OWNED:	536		
# Compliant:	27	509	To be Reconstructed
% Compliant:	5%		
TOTAL:	980		
# Compliant:	104	876	To be Reconstructed
% Compliant:	11%		

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	28	Yes	Yes				Yes	Yes	Good		Yes		1.2	1.8	1
	75	Yes	Yes				Yes	No	Good		Yes		1.3	3.6	0
	76	Yes	Yes				Yes	Yes	Good		Yes		1.6	2.0	1
	100	Yes	Yes				Yes	Yes	Good		Yes		1.4	1.0	1
	101	Yes	Yes				Yes	Yes	Good		Yes		1.1	1.2	1
	102	Yes	Yes				Yes	No	Good		Yes		0.5	3.4	0
	103	Yes	Yes				Yes	Yes	Good		Yes		5.0	1.1	1
	106	Yes	Yes				Yes	Yes	Good		Yes		0.3	1.1	1
	107	Yes	Yes				Yes	Yes	Good		Yes		0.1	1.5	1
	108	No	Yes				Yes	No	Poor	Pavement damage	No		1.5	5.3	0
	109	Yes	Yes				Yes	Yes	Good		Yes		0.9	1.8	1
	110	Yes	Yes				Yes	Yes	Good		Yes		0.7	1.5	1
	111	Yes	Yes				Yes	Yes	Good		Yes		0.4	0.9	1
	112	Yes	Yes				No	Yes	Fair		Yes	Ponding	5.1	0.1	0
	130	Yes	Yes				No	Yes	Good		Yes		6.7	1.3	0
	155	Yes	Yes				Yes	No	Good		Yes		0.2	2.3	0
	156	Yes	Yes				Yes	Yes	Fair		Yes		3.0	0.6	1
	157	Yes	Yes				Yes	Yes					0.4	1.0	1
	158	Yes	Yes				Yes	No	Good		No		0.2	3.2	0
	159	Yes	Yes				Yes	Yes	Fair		Yes		0.4	1.4	1
	160	Yes	Yes	N/A	N/A	N/A	No	No	Good		No		.25	2.2	0
	201	No	Yes				No	No	Poor	large roots	Yes	Ponding	9.1	11.1	0
	202	Yes	Yes				No	Yes	Good		Yes		18.0	1.9	0
	203	Yes	Yes				Yes	Yes	Good		Yes		3.1	1.8	1
	204	Yes	Yes				Yes	No	Good		Yes	Ponding	0.2	3.8	0
	205	Yes	Yes				Yes	No	Good		Yes		1.5	3.1	0
	206	Yes	Yes				Yes	No	Good		Yes		2.2	5.1	0
	207	Yes	Yes				Yes	No	Good		Yes		1.3	4.5	0
	208	Yes	Yes				Yes	No	Good		Yes		0.5	3.6	0
	209	Yes	Yes				Yes	No	Good		Yes		0.7	4.6	0
	210	Yes	Yes	N/A	N/A		Yes	No	Good		Yes		1.3	2.1	0
	211	Yes	Yes				Yes	Yes	Good		Yes		0.2	1.7	1
	212	Yes	Yes				Yes	No	Good		Yes		1.1	3.2	0
	219	Yes	Yes				Yes	Yes	Good		Yes		1.5	1	1
	220	Yes	Yes				Yes	Yes	Good		Yes		1.6	1.6	1
	221	Yes	Yes				Yes	No	Good		Yes		1.6	2.1	0
	225	Yes	Yes				Yes	No	Good		Yes		0.8	4.0	0
	226	Yes	Yes				Yes	Yes	Good		Yes		3.5	0.4	1
	227	Yes	Yes				Yes	No	Good		Yes		0.7	2.3	0
	228	Yes	Yes				Yes	No	Good		Yes		1.0	2.2	0
	232	Yes	Yes		Yes	Yes	Yes	Yes	Good	bridge	Yes		2.8	0.1	1
	233	Yes	Yes				Yes	Yes	Good		Yes		3.2	1.8	1
	234	Yes	Yes		N/A	N/A	Yes	No	Good		Yes		10.5	0.5	0
	235	Yes	Yes	N/A	Yes	Yes	Yes	Yes	Good	boardwalk. watch shrubs at entrance	Yes	Obstruction	5.0	0.0	1
	236	Yes	Yes				No	Yes	Good		Yes		10.4	1.3	0
	255	Yes	Yes				Yes	No	Good		Yes		1.0	2.4	0
	256	Yes	Yes				Yes	No	Good		Yes		0.3	3.8	0
	308	Yes	Yes				Yes	No	Good		Yes		0.2	3.6	0
	309	Yes	Yes				Yes	Yes	Good		Yes	Ponding	0.8	0.8	1
	310	Yes	Yes				Yes	No	Good		Yes		1.7	2.7	0
	311	No	Yes				Yes	Yes	Good		Yes		1.4	2	0
	312	No	Yes				Yes	No	Fair	Some vegetation	Yes		1.6	4.0	0
	313	Yes	Yes				Yes	No	Good		Yes		0.0	2.4	0
	314	Yes	Yes				Yes	Yes	Good		Yes		3.0	1.5	1
	315	Yes	Yes				Yes	No	Good		Yes		2.4	2.1	0
	316	No	Yes				Yes	Yes	Fair	Pavement damage	Yes		0.4	0.1	0
	317	Yes	Yes				Yes	Yes	Good		Yes		0.4	1.1	1
	318	Yes	Yes				Yes	No	Poor		Yes	Ponding	1.1	2.8	0
	319	Yes	Yes				Yes	Yes	Good		Yes		1.5	1.3	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	320	Yes	Yes				Yes	Yes	Fair		Yes		0.1	0.6	1
	335	Yes	Yes				Yes	Yes	Good		Yes		0.7	0.2	1
	336	Yes	Yes				Yes	No	Good		Yes		0.5	2.4	0
	337	Yes	Yes				Yes	Yes	Good		Yes		1.1	1.6	1
	338	Yes	Yes				Yes	No	Fair		Yes		0.1	2.7	0
	339	Yes	Yes				Yes	No	Fair	Some vegetation	Yes		0.6	2.7	0
	340	Yes	Yes				Yes	Yes	Good		Yes		1.6	1.8	1
	341	Yes	Yes				Yes	Yes	Good		Yes	Ponding	0.5	0.9	1
	342	Yes	Yes				Yes	Yes	Good			Ponding	0.6	1.1	1
	343	Yes	Yes				Yes	Yes	Good		Yes		0.3	0.2	1
	344	Yes	Yes				Yes	No	Good		Yes		0.3	2.1	0
	345	Yes	Yes				Yes	No	Good		Yes		0.8	2.3	0
	356	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Good		No		4	.85	0
	357	Yes	Yes	N/A	N/A	N/A	No	Yes	Good		Yes		6.45	1.65	0
	358	Yes	Yes	Yes	N/A	N/A	No	No	Good		No		8.7	2.75	0
	359	Yes	Yes	Yes	N/A	N/A	Yes	No	Fair		No		3.4	3.8	0
	360	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		8.55	5.9	0
	361	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8.55	.25	0
	362	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8.1	1	0
	363	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		.95	3.4	0
	364	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Fair		No		1	2	0
	365	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		12.15	2.5	0
	366	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes	Obstruction	9	1.3	0
	367	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		11.2	2.75	0
	368	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		7.6	1.2	0
	369	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		1.35	3.45	0
	370	Yes	Yes	Yes	N/A	N/A	No	Yes	Fair		No		8.45	.85	0
	371	Yes	Yes	N/A	N/A	N/A	No	No	Fair		No		12.85	3.4	0
	372	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		6.8	4.8	0
	373	Yes	No	Yes	N/A	N/A	No	Yes	Fair		Yes		5.55	.15	0
	374	Yes	No	Yes	N/A	N/A	No	No	Fair		Yes	Obstruction	13.3	3.2	0
	375	Yes	Yes	Yes	N/A	N/A	No	No	Fair		No		9.7	2.75	0
	376	Yes	Yes	Yes	N/A	N/A	No	Yes	Fair		Yes		11.2	1.2	0
	377	Yes	No	Yes	N/A	N/A	No	Yes	Good		Yes		10.55	.3	0
	378	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		6.7	2.35	0
	379	Yes	Yes	Yes	N/A	N/A	No	Yes	Good	Fire hydrant	Yes	Obstruction	7.85	.6	0
	380	Yes	No	Yes	N/A	N/A	Yes	Yes	Good		Yes		4	1.35	0
	381	Yes	No	Yes	N/A	N/A	No	No	Fair		Yes		5.4	5.15	0
	382	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		13.95	0.3	0
	383	Yes	Yes	Yes	N/A	N/A	No	No	Fair		No		18.4	5.65	0
	384	Yes	No	Yes	N/A	N/A	No	Yes	Good		Yes	Obstruction	6.35	1	0
	385	Yes	Yes	Yes	N/A	N/A	No	No	Poor		No		9.8	.5	0
	386	Yes	Yes	Yes	N/A	N/A	No	No	Fair		Yes		11.3	3.3	0
	387	Yes	No	Yes	N/A	N/A	Yes	No	Good	Grass has overgrown on sides	Yes		4.7	2.35	0
	388	Yes	Yes	Yes	N/A	N/A	No	No	Good		No		5.55	5.65	0
	389	Yes	Yes	Yes	N/A	N/A	Yes	No	Fair		No		2.75	4	0
	390	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		1.1	3.05	0
	391	Yes	Yes	Yes	N/A	N/A	Yes	No	Fair		No		.75	2.7	0
	392	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		1.9	2.35	0
	393	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Good		Yes		.3	1	1
	394	Yes	No	Yes	N/A	N/A	Yes	No	Good		Yes		.75	3.3	0
	395	Yes	No	Yes	N/A	N/A	No	No	Fair	Heavy Vegetation	Yes	Obstruction	8.35	3.1	0
	396	Yes	No	Yes	N/A	N/A	No	No	Good		No		5.75	2.05	0
	397	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8.35	1.8	0
	398	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		6.1	2.5	0
	399	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		4.85	2.15	0
	400	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		10.5	.4	0
	401	Yes	Yes	Yes	N/A	N/A	No	No	Fair		Yes		10	4	0
	402	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		2.15	3.1	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	403	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		5.75	1.8	0
	404	Yes	Yes	N/A	N/A	N/A	No	Yes	Fair	Vegetation between slabs	No		8.45	1.1	0
	405	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		3.9	2.95	0
	406	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Fair		Yes		.5	1.55	1
	407	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Good		No		4.35	1	0
	408	Yes	Yes	Yes	N/A	N/A	Yes	No	Fair		Yes		3.05	2.7	0
	409	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		2.8	2.8	0
	410	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		5.75	1	0
	411	Yes	Yes	Yes	N/A	N/A	No	No	Fair		Yes		6.7	2.5	0
	412	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		No		4.85	4	0
	413	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		5.55	2.4	0
	414	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		6.55	1.65	0
	415	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Good	Heavy Vegetation	Yes		2	.6	1
	416	Yes	No	Yes	N/A	N/A	No	No	Fair	Some vegetation	Yes		7.6	4.15	0
	417	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		1.45	4.15	0
	418	Yes	Yes	Yes	N/A	N/A	No	Yes	Good	Narrow due to vegetation	Yes		7.05	0.25	0
	419	Yes	Yes	Yes	N/A	N/A	No	No	Fair		No		8.65	2.15	0
	420	Yes	Yes	N/A	N/A	N/A	Yes	No	Fair		No		.4	2.05	0
	421	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		7.25	1.55	0
	422	Yes	Yes	Yes	N/A	N/A	No	Yes	Good	Driveway	Yes		12.45	.15	0
	423	Yes	Yes	Yes	N/A	N/A	No	No	Fair		No		10.05	2.85	0
	424	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8.7	1	0
	425	Yes	Yes	N/A	N/A	N/A	No	No	Good		Yes		10.2	2.6	0
	426	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		2.6	15.1	0
	427	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Poor	Some vegetation	Yes		3.55	.25	0
	428	Yes	No	Yes	N/A	N/A	Yes	No	Fair		Yes		1	4	0
	429	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		5.2	4.35	0
	430	Yes	No	Yes	N/A	N/A	Yes	Yes	Good		Yes		3.05	1.3	0
	431	Yes	Yes	Yes	N/A	N/A	Yes	No	Good		Yes		2.15	6.55	0
	432	Yes	No	Yes	N/A	N/A	Yes	Yes	Good		Yes		1.7	1.2	0
	433	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		15.2	2.05	0
	434	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		10.4	.95	0
	435	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		11.35	1	0
	436	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		10.3	1.45	0
	437	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Fair		No		1.35	1	0
	438	Yes	Yes	Yes	N/A	N/A	No	Yes	Good		Yes		8.2	.4	0
	439	Yes	Yes	Yes	N/A	N/A	Yes	Yes	Good		Yes		2	.75	1
	440	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		13.65	3	0
	441	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Good		Yes		1.45	1.2	1
	442	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		1.2	2.4	0
	443	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		.75	2.75	0
	444	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Good		Yes	Obstruction	2.95	.05	1
	445	Yes	No	N/A	N/A	N/A	Yes	Yes	Good		Yes	Obstruction	3.65	.4	0
	446	Yes	No	N/A	N/A	N/A	Yes	No	Good		Yes	Obstruction	3.65	2.35	0
	447	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		.25	4.8	0
	448	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		.4	5.15	0
	449	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Fair		No		1.7	1	0
	450	Yes	Yes	N/A	N/A	N/A	Yes	Yes	Good		Yes		1	.75	1
	451	Yes	Yes	N/A	N/A	N/A	Yes	No	Fair		Yes		1.3	2.5	0
	452	Yes	No	Yes	N/A	N/A	Yes	No	Poor		No		4.35	2.05	0
	453	Yes	Yes	Yes			Yes	Yes	Good		Yes		0.2	1.5	1
	454	Yes	Yes				No	Yes	Fair	driveway			6.5	0.8	0
	455	Yes	Yes				Yes	No	Fair		Yes	Ponding	1.1	21.2	0
	456	Yes	Yes				Yes	No	Good		Yes		4.2	5.6	0
	457	Yes	Yes				Yes		Good		Yes		2.4	0.6	1
	458	Yes	Yes				Yes	Yes	Fair		Yes	Ponding	1.4	1.6	1
	459	Yes	Yes	N/A	Yes	Yes	Yes	Yes	Good	vertical	No		0.4	1.1	0
	472	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	0.3	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	473	Yes	Yes				Yes	No	Fair		No		1.6	2.9	0
	474	Yes	Yes	N/A			Yes	No	Fair		Yes	Ponding	1.3	2.6	0
	475	Yes	Yes	Yes	N/A	N/A	No	No	Good		Yes		6.95	5.15	0
	476	Yes	No	N/A	N/A	N/A	Yes	Yes	Good		Yes		0	1.55	0
	477	Yes	Yes	N/A	N/A	N/A	Yes	No	Good		Yes		1.1	2.5	0
	663	Yes	Yes	N/A			Yes	No	Fair		Yes	Ponding	2.5	2.3	0
	664	Yes	Yes	N/A			Yes	No	Fair	Some cracking and potholes	Yes	Ponding	0.0	4.7	0
	665	Yes	Yes		N/A		Yes	Yes	Good		Yes		3.7	0.7	1
	666	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.2	1.7	1
	667	Yes	Yes	N/A			No	Yes	Fair	Some cracking	No		11.8	0.4	0
	668	Yes	Yes	N/A			Yes	Yes	Good	Some vegetation	Yes		2.4	0.4	1
	669	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes	Ponding	4.6	2.7	0
	670	Yes	Yes	N/A			Yes	Yes	Poor	Some cracking and vegetation	No	Obstruction	4.2	0.7	0
	671	Yes	Yes	N/A			No	No	Poor	Some cracking and vegetation	Yes		5.6	16.6	0
	672	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.0	1.3	1
	673	Yes	Yes	N/A			Yes	Yes	Fair	look at pic	No		2.6	0.3	0
	674	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.2	1
	675	Yes	Yes	N/A			No	Yes	Fair	horizontal gap			6.2	0	0
	684	Yes	Yes	N/A			Yes	No	Fair		Yes	Ponding	3.4	2.1	0
	685	Yes	Yes	N/A			Yes	Yes	Fair	steepest spot has railing	Yes	Ponding	1.8	1.2	1
	686	Yes	Yes	N/A			Yes	No	Good		Yes		2.6	3.5	0
	687	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	1.7	1
	688	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.6	1
	689	Yes	Yes	N/A	N/A	N/A		No	Good		Yes		0.7	3.4	0
	690	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.0	1.3	1
	691	Yes	Yes	N/A			Yes	No	Good		Yes		0.1	2.2	0
	692	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	2.2	0
	693	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.5	1
	694	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	1.5	1
	695	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.0	0	1
	696	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	2.0	1
	697	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	1.6	1
	698	Yes	Yes	N/A			Yes	No	Good		Yes	Obstruction	0	3.2	0
	699	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.9	1
	700	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	0.7	1
	705	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.2	1
	706	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	3.55	0
	707	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.95	1.55	1
	1071	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.4	0.3	1
	1072	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.8	0.7	1
	1073	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.9	1
	1074	Yes	Yes	N/A			Yes	No	Good		Yes		2.0	2.3	0
	1099	Yes	Yes	N/A			Yes	No	Good		Yes		1.1	3.1	0
	1100	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	5.5	0
	1101	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.4	1
	1102	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.0	1.7	1
	1103	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.9	0.8	1
	1104	Yes	Yes	N/A			Yes	No	Good		Yes		1.0	3.1	0
	1105	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	2.0	1
	1106	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	2.7	0
	1107	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	2.0	1
	1108	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	2.2	0
	1109	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.5	1.0	1
	1110	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	2.9	0
	1111	Yes	Yes	N/A				Yes	Good		Yes		2.7	1.7	1
	1112	Yes	Yes	N/A			Yes	Yes	Good		Yes		0	1.3	1

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	1113	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.45	1.8	1
	1114	Yes	Yes	N/A			Yes	Yes	Good		Yes		2	1.7	1
	1115	Yes	Yes	N/A			Yes	No	Good		Yes		1.2	2.5	0
	1185	Yes	Yes	N/A			Yes	No	Good		Yes		2.4	3.1	0
	1186	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	2.7	0
	1187	Yes	Yes	N/A			Yes	No	Good		Yes		1.3	2.6	0
	1188	Yes	Yes	N/A			Yes	No	Good		Yes		1.1	2.8	0
	1189	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	2.0	1
	1190	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	1.5	1
	1191	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.3	1.7	1
	1192	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.9	1.9	1
	1193	Yes	Yes	N/A			Yes	No	Good		Yes		4.3	4.7	0
	1194	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.0	2.0	1
	1195	Yes	Yes	N/A			Yes	No	Good		Yes		0.0	2.2	0
	1196	Yes	Yes	N/A			Yes	No	Good		Yes		1.5	9.3	0
	1197	Yes	Yes	N/A			Yes	No	Good		Yes		0.8	2.9	0
	1198	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.9	1
	1199	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	2.0	1
	1200	Yes	Yes	N/A			Yes	No	Fair	Some cracking	Yes	Ponding	2.8	2.2	0
	1201	Yes	Yes	N/A			No	No	Poor		Yes	Ponding	8.2	5.5	0
	1202	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.7	1.4	1
	1203	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.5	1.4	1
	1204	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	1.7	1
	1205	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	0.7	1
	1206	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.6	1.9	1
	1207	Yes	Yes	N/A			Yes	No	Good		Yes		0.0	5.1	0
	1208	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.4	1.0	1
	1209	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	1.1	1
	1210	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.9	1
	1211	Yes	Yes	N/A			Yes	No	Good		Yes		1.2	3.4	0
	1212	Yes	Yes	N/A			Yes	No	Good		Yes		3.6	2.3	0
	1213	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.3	1
	1214	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	0.5	1
	1215	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	0.2	1
	1330	Yes	Yes	N/A			No	No	Good		Yes		8.1	3.4	0
	1331	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.0	1.2	1
	1332	Yes	Yes	N/A			Yes	Yes	Good		No		2.2	0.9	0
	1333	Yes	Yes	N/A			Yes	No	Good		Yes		3.1	2.5	0
	1334	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.3	1.8	1
	1335	Yes	Yes	N/A			No	Yes	Good		Yes		9.5	0.9	0
	1336	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.2	0.5	1
	1337	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.9	2.0	1
	1338	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Ponding	2.8	1.6	1
	1339	Yes	Yes	N/A			No	Yes	Good		Yes		9.8	0.2	0
	1349	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	4.7	0
	1350	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.7	0.8	1
	1351	Yes	Yes	N/A			Yes	No	Good		Yes		2.7	3.1	0
	1352	Yes	Yes	N/A			Yes	Yes	Fair		Yes		1.9	1.1	1
	1353	Yes	Yes	N/A			No	Yes	Good		Yes		5.3	1.2	0
	1429	Yes	Yes	N/A			No	No	Good		Yes		9.2	2.6	0
	1430	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.7	1
	1449	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.7	1.6	1
	1450	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.4	0.3	1
	1451	Yes	Yes	N/A			Yes	No	Good		Yes		2.9	2.9	0
	1453	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.2	0.4	1
	1454	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.1	1
	1455	Yes	Yes	N/A			Yes	No	Good		Yes		2.0	2.1	0
	1456	Yes	Yes	N/A			Yes	Yes	Fair	Some cracking	Yes		0.5	1.5	1
	1457	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.6	1
	1467	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	2.8	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	1468	Yes	Yes	N/A			Yes	No	Good		Yes		2.7	3.8	0
	1469	Yes	Yes		No		Yes	Yes	Good	railroad	No		0.2	0.1	0
	1472	Yes	Yes	N/A			Yes	No	Good		Yes		2.1	3.8	0
	1473	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	2.0	1
	1474	Yes	Yes	N/A			Yes	No	Good		Yes		2.3	3.9	0
	1475	Yes	Yes	N/A			Yes	No	Good		Yes		0.6	3.8	0
	1476	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.6	1.8	1
	1477	Yes	Yes	N/A				No	Good		Yes		2.0	6.5	0
	1478	Yes	Yes	N/A			Yes	No	Good		Yes		1.7	2.7	0
	1479	Yes	Yes	N/A			Yes	No	Good		Yes		0.2	4.3	0
	1480	Yes	Yes	N/A			Yes	No	Good		Yes		0.3	4.0	0
	1481	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	4.2	0
	1482	Yes	Yes	N/A			Yes	No	Good		Yes		4.3	2.5	0
	1483	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.4	1.8	1
	1484	Yes	Yes	N/A			Yes	No	Good		Yes		2.4	5.9	0
	1485	Yes	Yes	N/A			No	Yes	Good		Yes		6.3	0.5	0
	1486	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	9.0	0
	1487	Yes	Yes	N/A			Yes	No	Good		Yes		1.2	10.9	0
	1488	Yes	Yes	N/A			Yes	No	Good		Yes		3.6	6.2	0
	1489	Yes	Yes	N/A			Yes	No	Good		Yes		3.0	2.7	0
	1490	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.1	0
	1491	Yes	Yes	N/A			Yes	No	Good		Yes		2.3	2.7	0
	1492	Yes	Yes	N/A			Yes	No	Good		Yes		4.6	2.8	0
	1493	Yes	Yes	N/A			Yes	No	Good		Yes		0.4	3.2	0
	1494	Yes	Yes	N/A			Yes	No	Good		Yes		1.8	2.2	0
	1508	Yes	Yes	N/A			Yes	Yes	Good		Yes		12.9	2.0	1
	1564	Yes	Yes	N/A			Yes	No	Good		Yes		0.7	2.3	0
	1565	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.5	1.7	1
	1566	Yes	Yes	N/A			Yes	Yes	Fair	Some vegetation	Yes		3.5	0.7	1
	1567	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.1	1.2	1
	1568	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.9	1.9	1
	1569	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.9	1.3	1
	1570	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.6	0.5	1
	1571	Yes	Yes	N/A			Yes	No	Good		Yes		1.0	2.9	0
	1587	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	4.3	0
	1588	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.7	1.2	1
	1589	Yes	Yes	N/A			Yes	No	Good		Yes		0.5	2.7	0
	1590	Yes	Yes	N/A			Yes	Yes	Good		Yes		2.4	2.0	1
	1591	Yes	Yes	N/A			Yes	No	Good		Yes		0.3	3.6	0
	1592	Yes	Yes	N/A			No	No	Good		Yes		14.2	2.6	0
	1593	Yes	Yes	N/A			No	No	Good		Yes		11.2	6.7	0
	1594	Yes	Yes	N/A			Yes	No	Good		Yes		4.3	2.5	0
	1595	Yes	Yes	N/A			No	Yes	Good		Yes		13.7	1.4	0
	1628	Yes	Yes	N/A			No	No	Good		Yes		15.0	3.5	0
	1629	Yes	Yes	N/A			Yes	Yes	Good		Yes		1.2	0.7	1
	1637	Yes	Yes	N/A			Yes	No	Good		Yes	Obstruction	0.4	2.7	0
	1638	Yes	Yes	N/A			Yes	Yes	Fair		Yes	Obstruction	1.1	0.3	1
	1639									under construction					0
	1641	Yes	Yes	N/A			Yes	No	Fair	Some vegetation	Yes	Ponding	0.7	6.4	0
	1642	Yes	Yes	N/A			Yes	No	Good		Yes		2.5	4.3	0
	1643	Yes	Yes	N/A			Yes	Yes	Good		Yes		4.8	1.8	1
	1644	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	2.4	0
	1667	Yes	Yes	N/A			Yes	Yes	Good	under construction	Yes		1.9	1.6	1
	1668	Yes	Yes	N/A			Yes	Yes	Good	under construction	Yes		5.0	1.5	1
	1669	Yes	Yes	N/A			No	Yes	Good		Yes		5.9	1.0	0
	1670	Yes	Yes	N/A			Yes	Yes	Good		Yes		3.8	1.6	1
	1686	Yes	Yes	N/A			Yes	Yes	Good		Yes		0.8	2.0	1
	1687	Yes	Yes	N/A			Yes	No	Good		Yes		1.4	4.2	0
	1697	Yes	Yes	N/A			Yes	Yes	Fair		No		2.25	1.55	0
	1698	Yes	Yes	N/A			Yes	No	Good		Yes		2.35	2.6	0

Ownership	OBJECTID	Is the route stable, firm and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	Is the cross slope no steeper than 2%?	Sidewalk overall condition	Notes	Are there no gaps in elevations or distances between concrete panels > 1.5?	Obstruction or Ponding?	What is the running slope?	What is the Cross slope?	Compliant 1=Compliant
	1699	Yes	Yes	N/A			Yes	Yes	Fair		Yes		4	1.55	1


COUNTY/MnDOT:	353	
# Compliant:	126	227 To be Reconstructed
% Compliant:	36%	

CITY OWNED:	573	
# Compliant:	254	319 To be Reconstructed
% Compliant:	44%	

TOTAL	926	
# Compliant:	380	546 To be Reconstructed
% Compliant:	41%	

B-2: External agency traffic control signal location map

The map provides a geographic description of traffic control signals within the city by jurisdiction (County or MnDOT).

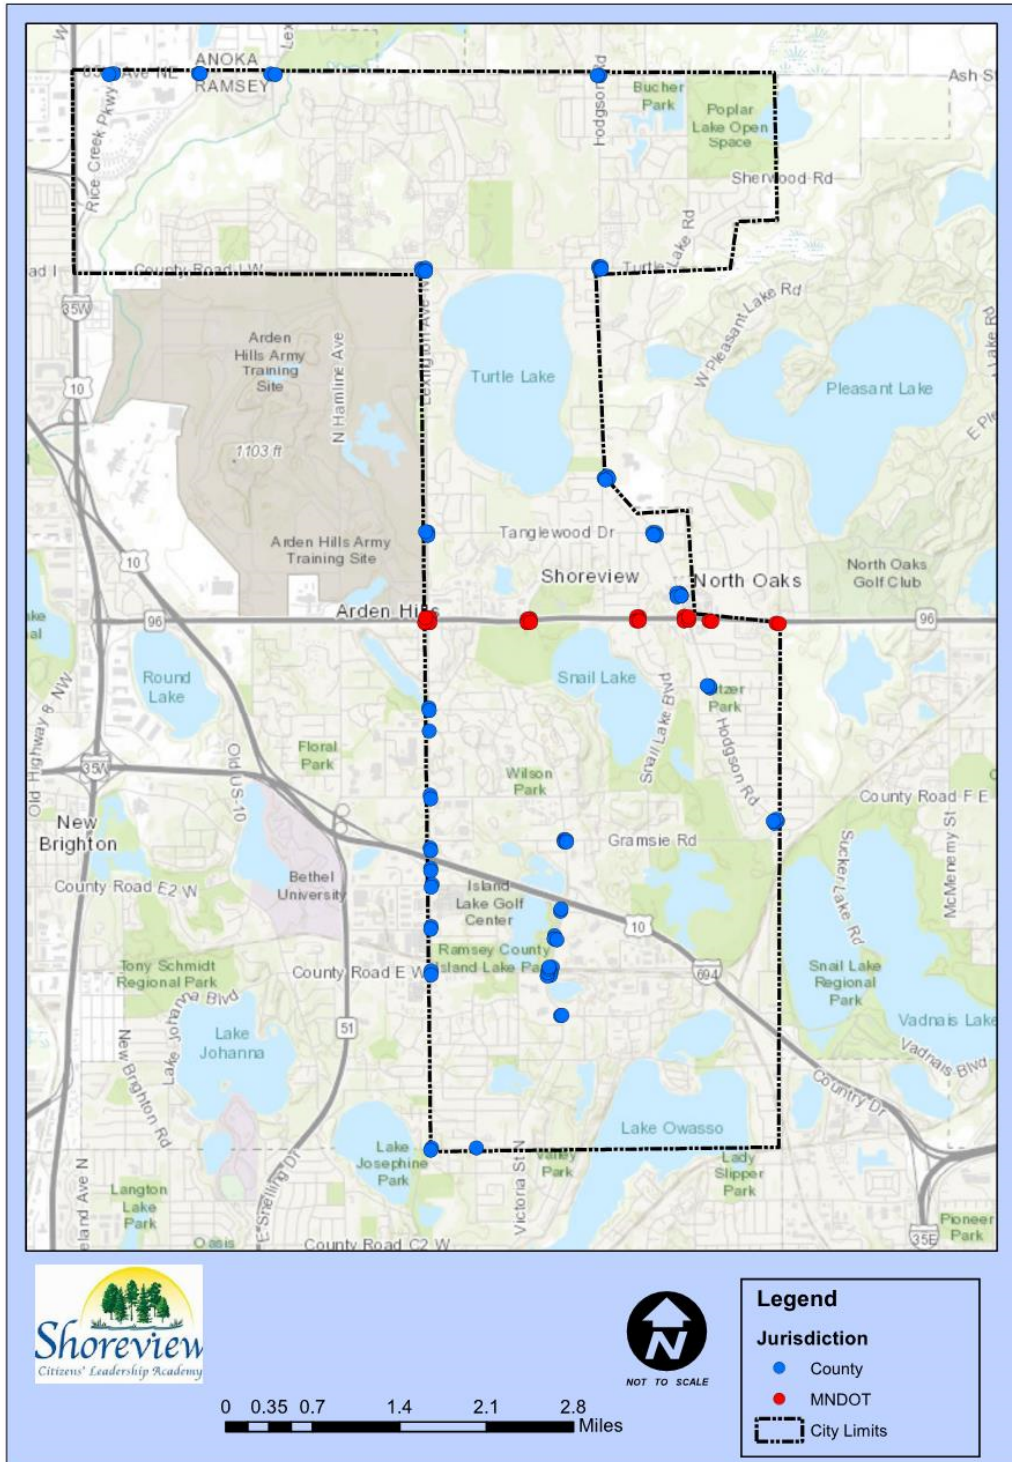

B-3: External agency traffic control signal self-evaluation inventory



OBJECTID	Jurisdiction	Push button <= 5ft of outside edge of crosswalk?	Push button face oriented parallel w\ crosswalk?	4'x4' flat landing adjacent to each push button?	Push button btwn 1.5ft & 10ft from back of curb?	>= 10ft of separation between push buttons?	Push button mounted >=42in and <=48in?	Is a 4 foot PAR w/ 2% cross slope maintained?	Is there an audible walk indication?	Vibrotactile arrow present and correct dir?	Notes	Compliant 1=Compliant
1	County	Yes	Yes	No	No		Yes	No	Yes	No	no arrow on North crossing	0
2	County	Yes	Yes	No	Yes		Yes	No	Yes	No	arrow on one button not on North crossing	0
3	County	Yes	Yes	No	Yes		No	No	Yes	No		0
4	County	Yes	Yes	No	No				Yes	No		0
5	County	Yes	Yes	No	Yes		Yes	No	Yes	No		0
6	County	Yes	Yes	No	Yes		Yes	No	Yes	No		0
7	County	Yes	Yes	Yes	Yes		Yes	Yes	Yes	No		0
28	County	Yes	Yes	No	Yes		Yes	No	Yes	No		0
29	County	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes		1
30	County	Yes	Yes	No	Yes	Yes	Yes	No	Yes	Yes		0
31	County	Yes	Yes	No	Yes		Yes	No	No	No	nails in near button. button on Street side.	0
32	County	Yes	Yes	Yes	Yes		No		No	No	nails	0
33	County	Yes	Yes	No	Yes		Yes		Yes	No		0
34	County	Yes	Yes	No	Yes		Yes		No	No		0
37	County	Yes	Yes	Yes	Yes		Yes		No	No	rust	0
38	County	Yes	Yes	Yes	Yes		Yes		No	No		0
39	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
40	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
41	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
42	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
43	MNDOT	Yes	Yes	Yes	Yes		Yes		No	No		0
44	County	Yes	Yes	No	Yes		No		No	No		0
45	County	Yes	Yes	No	Yes		Yes		No	No		0
46	County	Yes	Yes	Yes	Yes	No	Yes		Yes	Yes		0
47	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
48	County	Yes	Yes	No	Yes	No	Yes		Yes	Yes		0
49	County	Yes	Yes	Yes	No	Yes	Yes		Yes	Yes		0
50	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
51	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
52	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
53	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
75	County	Yes	Yes	No	Yes	No	Yes		Yes	Yes		0
76	County	Yes	Yes	No	Yes	No	Yes		Yes	Yes		0
77	County	Yes	Yes	No	Yes	No	Yes		Yes	Yes		0
78	County	Yes	Yes	Yes	Yes	No	Yes		Yes	Yes		0
79	County	Yes	Yes	Yes	Yes	No	Yes		Yes	Yes		0
80	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
81	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
82	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1

OBJECTID	Jurisdiction	Push button <= 5ft of outside edge of crosswalk?	Push button face oriented parallel w\ crosswalk?	4'x4' flat landing adjacent to each push button?	Push button btwn 1.5ft & 10ft from back of curb?	>= 10ft of separation between push buttons?	Push button mounted >=42in and <=48in?	Is a 4 foot PAR w/ 2% cross slope maintained?	Is there an audible walk indication?	Vibrotactile arrow present and correct dir?	Notes	Compliant 1=Compliant
83	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
84	MNDOT		Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
85	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
86	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
87	MNDOT	Yes	Yes	No	Yes	No	Yes		Yes	Yes		0
95	County	Yes	Yes	No	Yes	Yes	Yes		No	Yes	leftmost APS isn't working or making sound. The right one has sound	0
96	MNDOT	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
97	MNDOT	Yes	Yes	No	Yes	Yes	Yes	No	Yes	Yes		0
98	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
99	MNDOT	Yes	Yes	No	Yes				No	No		0
100	County	Yes	Yes	No	Yes		Yes		No	No		0
101	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
102	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
103	MNDOT	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
104	MNDOT	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
105	MNDOT	Yes	Yes	No	Yes		Yes		No	No		0
106	County	Yes	Yes	No	Yes		Yes		No	No		0
107	County	Yes	Yes	No	Yes		Yes		No	No		0
125	County	Yes	Yes	No	Yes		No		No	No		0
126	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
127	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
137	County	Yes	Yes	No	Yes	Yes	Yes		No	No		0
138	County	Yes	Yes	No	Yes	Yes	Yes		No	No		0
139	County	Yes	Yes	No	Yes	Yes	Yes		No	No		0
140	County	Yes	Yes	No	Yes	Yes	Yes		No	No		0
141	County	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
142	County	Yes	Yes	No	Yes		Yes		Yes	Yes		0
143	County	Yes	Yes	No	Yes		Yes		Yes	Yes		0
144	County	Yes	Yes	Yes	Yes		Yes	Yes	Yes	Yes		1
145	County	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
146	County	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
147	County	Yes	Yes	No	Yes	Yes	Yes		No	No		0
148	County	Yes	Yes	No	Yes	Yes	Yes		No	No	push button and crosswalk doesn't match up with one button	0
149	County	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
150	County	Yes	Yes	Yes	Yes	No	Yes		Yes	Yes		0
151	County	Yes	Yes	Yes	Yes	Yes	Yes		No	No		0

OBJECTID	Jurisdiction	Push button <= 5ft of outside edge of crosswalk?	Push button face oriented parallel w\ crosswalk?	4'x4' flat landing adjacent to each push button?	Push button btwn 1.5ft & 10ft from back of curb?	>= 10ft of separation between push buttons?	Push button mounted >=42in and <=48in?	Is a 4 foot PAR w/ 2% cross slope maintained?	Is there an audible walk indication?	Vibrotactile arrow present and correct dir?	Notes	Compliant 1=Compliant
152	County	Yes	Yes	Yes	Yes	Yes	Yes		No	No		0
153	County	Yes	Yes	No	Yes		Yes		No	No	not intersection	0
154	County	Yes	Yes	No	Yes		Yes		No	No		0
155	County	Yes	Yes	No	Yes		Yes		No	No		0
156	County	Yes	Yes	No	Yes		Yes		No	No		0
157	County	Yes	Yes	Yes	Yes		Yes		Yes	Yes		1
158	County	Yes	Yes	Yes	Yes		Yes		Yes	Yes		1
159	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
160	County	Yes	Yes	No	Yes		Yes		Yes	Yes		0
161	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
162	County	Yes	Yes	No	Yes		Yes		No	Yes	no traffic light	0
163	County	Yes	Yes	No	Yes		Yes		No	No	no traffic light	0
164	County	Yes	Yes	No	Yes	Yes	Yes		Yes	Yes		0
165	County	Yes	Yes	Yes	Yes		Yes		Yes	Yes		1
166	County	Yes	Yes	Yes	Yes		Yes		Yes	Yes		1
167	County	Yes	Yes	Yes	Yes	Yes	Yes		Yes	Yes		1
168	County	Yes	Yes	No	Yes		Yes		No	No		0
169	County	Yes	Yes	No	Yes		Yes		Yes	Yes		0
170	County	Yes	Yes	No	Yes		Yes		No	No		0
171	County	Yes	Yes	No	Yes		Yes		No	No		0

TOTAL:	95
# Compliant:	31
% Compliant:	33%